

## Case 246 : Narrative

Case Vehicle (A): 1999 Ford	Vehicle (B): 1997 Ford	Vehicle (C): 1992 Mercury
Type: Taurus SE, 4-door sedan	Type: F150 XLT, 4x2 pickup	Type: Grand Marquis LS, 4-door sedan
Driver: 50-year-old female	Driver: Unknown	Driver: Unknown
CDC: 12-FDEW-3, 03-RFEW-2	CDC: 12-FDEW-3, 99-0000-0, 03-RBEW-2	CDC: 12-FYEW-2, 99-0000-0

### SITUATION

[1](#) [2](#) On a clear day, case vehicle (A) was traveling north at an unknown speed in the left-northbound lane of a six-lane asphalt road in urban area, and was approaching an intersection with a five-lane road. The road surface was dry, it was daylight, and the speed limit was 45 mph (72 kph). The road is equipped with a traffic light at the intersection. [3](#) Vehicle (B) was traveling south at an unknown speed in the left-turn lane of the same roadway. Vehicle (C) was traveling north in the right lane to the right of, and slightly behind, case vehicle (A). The beginning of the crash sequence occurred when vehicle (B) sideswiped vehicle (Y), which was traveling north through the intersection. After that impact, vehicle (B) crossed the centerline and entered the northbound lane. As case vehicle (A) was proceeding through the intersection, it was struck in the front by the front of vehicle (B). After the impact, case vehicle (A) rotated clockwise and entered the right northbound lane. The driver of vehicle (C) was unable to keep his vehicle from striking the right fender of case vehicle (A) with its front. After the impact with case vehicle (A), vehicle (B) rotated counterclockwise and was also struck by the front of vehicle (C) in the right rear. All vehicles were towed from the scene and the occupants were transported to local hospitals.

## GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES

[4](#) The direct damage to the front of case vehicle (A) began at the left-front bumper corner and extended 148 cm across the entire front of the vehicle. The maximum crush was 64 cm to the left side of the front bumper. [5](#) The direct damage to the right side of case vehicle (A) began at the right-front bumper corner and extended 102 cm rearward along the right fender. The maximum crush from this second impact was 16 cm to the fender.

[6](#) [7](#) The direct damage to vehicle (B) began at the left-front bumper corner and extended 180 cm across the entire front. The maximum crush was 57 cm to the left-front bumper corner. [8](#) There was direct damage to the right-rear truck bed from the impact with vehicle (C), beginning at the right-rear bumper corner and extending 161 cm forward across the truck bed. The maximum crush from this third impact was 26 cm to the quarter panel.

[9](#) The direct damage to vehicle (C) from the impact with case vehicle (A) began at the left-front bumper corner and extended 130 cm across the front, resulting in 75-percent vehicle overlap. The maximum crush was 43 cm to the left-front bumper corner.

[10](#) [11](#) [12](#) [13](#) [14](#) [15](#) Using the WinSMASH accident-reconstruction program and measurements for case vehicle (A), the following impact severity was calculated for the frontal impact with vehicle (B):

Vehicle	Variable	Calculated Velocity Change - kph (mph)		
		Total	Longitudinal	Latitudinal
Case Vehicle (A)	EBS	40 (25)	-38 (-24)	10 (6)

## DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)

### Exterior

[16](#) The front bumper was crushed, the grille was damaged, and both headlight assemblies were broken. [17](#) The hood was crushed and pushed rearward, and the hood latch was damaged. The rear edge of the hood was elevated, but it did not contact the windshield. Both hood hinges were deformed, but not separated. [18](#) The right portion of the windshield was cracked due to contact by the passenger frontal-impact airbag cover.

[19](#) [20](#) On the left side, the front fender was crushed and shifted slightly to the right from the right-side impact, and the left-front axle was deformed. [21](#) There was no damage to the upper or lower portions of the left A-, B-, or C-pillars, no deformation to the left door panels, and both doors were operable. The left wheelbase was decreased by 7 cm. There was no other damage to the left side of case vehicle (A).

[22](#) [23](#) On the right side, the front fender was crushed due to the impact with vehicle (C). [24](#) [25](#) The right-front wheel was damaged, the right-rear tire was deflated, and the right wheelbase was decreased by 6 cm. [26](#) There was no damage to the upper or lower portions of the A-, B-, or C-pillars and both doors were operational. There was no other damage to the right side of case vehicle (A).

[27](#) There was no damage to the rear of case vehicle (A).

### Interior

[28](#) This vehicle is equipped with steering-wheel and passenger frontal-impact airbags, which deployed during the frontal impact. [29](#) [30](#) There was no damage to the steering-wheel rim and no rotation of the steering column. [31](#) There were facial makeup transfers on the center-right portion of the driver airbag, indicating driver contact. [32](#) There was no damage to the upper or mid portions of the instrument panel. [33](#) The knee bolster

was damaged from driver contact. [34](#) [35](#) There was no damage to the center portion of the instrument panel or glove compartment area. [36](#) There was no damage to the foot controls or floor in the driver area. [37](#) [38](#) The passenger frontal-impact airbag cover contacted and cracked the right portion of the windshield. [39](#) There was no damage or evidence of occupant contact to the roof, windshield, and header areas. [40](#) There was no interior damage in the rear seating area. [41](#) The rear of the driver backrest was somewhat deformed and was probably contacted by the left-rear occupant and there were blood transfers on the seatback. [42](#) There was no other interior damage and no intrusions were noted.

## **OCCUPANT KINEMATICS AND INJURIES**

The 5-ft, 8-in, 138-lb, 50-year-old female driver was wearing the three-point belt, and the steering-wheel airbag deployed. [43](#) [44](#) Plastic transfers on the shoulder-belt webbing from the D-ring indicate that the driver was using the belt.

During the frontal impact, she moved forward relative to the vehicle interior, into the belt restraint and airbag. Her face contacted the airbag as indicated by facial makeup on it, but there were no known facial injuries. [45](#) She sustained a fracture to the right patella from contact with the right portion of the knee bolster.

[46](#) [47](#) [48](#) The 5-ft, 120-lb, 9-year-old female left-rear passenger was wearing the three-point belt improperly with the shoulder portion behind her. [49](#) [50](#) The plastic cover around the latch plate was damaged, and the webbing was cut by rescue personnel, indicating that the belt was in use at the time of the crash. She reportedly was sleeping, perhaps leaning to her left prior to the crash. During the frontal impact, she moved forward relative to the vehicle interior. [51](#) [52](#) She sustained lacerations to the right side of her forehead (4-cm full-thickness joining an 11-cm laceration with a Y-shape complex), possibly from contact with the B-pillar, as indicated by a scuff mark on the lower portion of the B-pillar, or possibly from contact with a large wheeled duffel bag

located in the rear seat, or possibly from contact with the door. She sustained a 4-cm long full-thickness laceration, to her left temple, probably from contact with the interior door area. [53](#) [54](#) She sustained several abdominal injuries from loading by the lap belt, including an intimal tear to the right posterolateral aspect of the terminal aorta extending to the right common iliac origin, tears to the mesentery and small bowel, and a small bowel deserosalization. In addition, she sustained contusions across the lower abdomen and complete disruption of the anterior abdominal wall musculature from loading of the lap belt. [55](#) She also sustained contusions to her right medial calf and right ankle, possibly from contact with the rear portion of the driver seat bottom.

The following tables [56](#) [57](#) and attached drawings summarize the injuries for the two occupants.

Occupant: Driver	Age: 50 years	Gender: Female		
Restraints: 3-point belt worn; airbag deployed	Stature: 173 cm (5 ft, 8 in)	Mass: 63 kg (138 lb)		
Injury Description	A.I.S.	Injury Source		
—	—	Definite	Probable	Possible
Fracture, right patella	2	Knee bolster	—	—
Maximum A.I.S. Level	2	—	—	—
Injury Severity Score	4	—	—	—

Occupant: Left rear	Age: 9 years	Gender: Female		
Restraints: 3-point belt worn improperly with shoulder belt behind back	Stature: 152 cm (5 ft)	Mass: 54 kg (120 lb)		
Injury Description	A.I.S.	Injury Source		
—	—	Definite	Probable	Possible
Lacerations, right forehead (4-cm long, full-thickness joining an 11-cm laceration with a Y-shape complex)	2	—	—	B-pillar, cargo, door interior
Laceration, left temple (4-cm long, full-thickness)	1	—	Door interior area	—
Intimal tear to right posterolateral aspect of terminal aorta	4	Lap belt extending to the right common iliac origin (confined to L4 level)	—	—
Tear, small bowel	2	Lap belt	—	—
Tear, mesentery	2	Lap belt	—	—
Small bowel deserosalization (sigmoid near circumferential segmental deserosalization)	2	Lap belt	—	—
Contusions, across lower abdomen	1	Lap belt	—	—
Complete disruption of anterior abdominal wall musculature	2	Lap belt	—	—
Contusions, right medial calf	1	—	—	Rear of driver seat bottom
Contusions, right ankle	1	—	—	Rear of driver seat bottom
Maximum A.I.S. Level	4	—	—	—
Injury Severity Score	24	—	—	—

CASE NO.: 246-01

CASE VEHICLE: 1999 Ford

TYPE: Taurus SE, 4-door sedan

OCCUPANT: (Driver) 50-year-old female

STATURE: 173 cm (5 ft, 8 in)

MASS: 63 kg (138 lb)

RESTRAINTS: 3-point belt worn; airbag deployed

SEVERITY: MAIS - 2

ISS - 4



Fracture, right patella  
(2)





CASE NO.: 246-01

CASE VEHICLE: 1999 Ford

TYPE: Taurus SE, 4-door sedan

OCCUPANT: (Left rear): 9-year-old female

STATURE: 152 cm (5 ft)      MASS: 54 kg (120 lb)

RESTRAINTS: 3-point belt worn improperly with  
shoulder belt behind back

SEVERITY: MAIS - 4      ISS - 24

Lacerations, right forehead - 4-cm long, full-thickness joining  
an 11-cm laceration with a Y-shape complex  
(2)

Laceration, left temple - 4-cm long  
full-thickness  
(1)

Intimal tear to right posterolateral  
aspect of terminal aorta extending  
to the right common iliac origin  
(4)

Small bowel deserosalization  
(2)

Tear, small bowel  
(2)

Tear, mesentery  
(2)

Contusions, right medial calf  
(1)

Contusions, right ankle  
(1)

Contusions, across  
lower abdomen  
(1)


Complete disruption of the  
anterior wall musculature  
(2)





Case No.: 246-01  
Case Veh. (A): 1999 Ford  
Type: Taurus SE, 4-door sedan  
Driver: 50-year-old female  
Vehicle (B): 1997 Ford F150 pickup  
Vehicle (C): 1992 Mercury Grand Marquis

Weather: Clear  
Road Surface: Dry  
Road Construction: Asphalt  
Light Conditions: Daylight

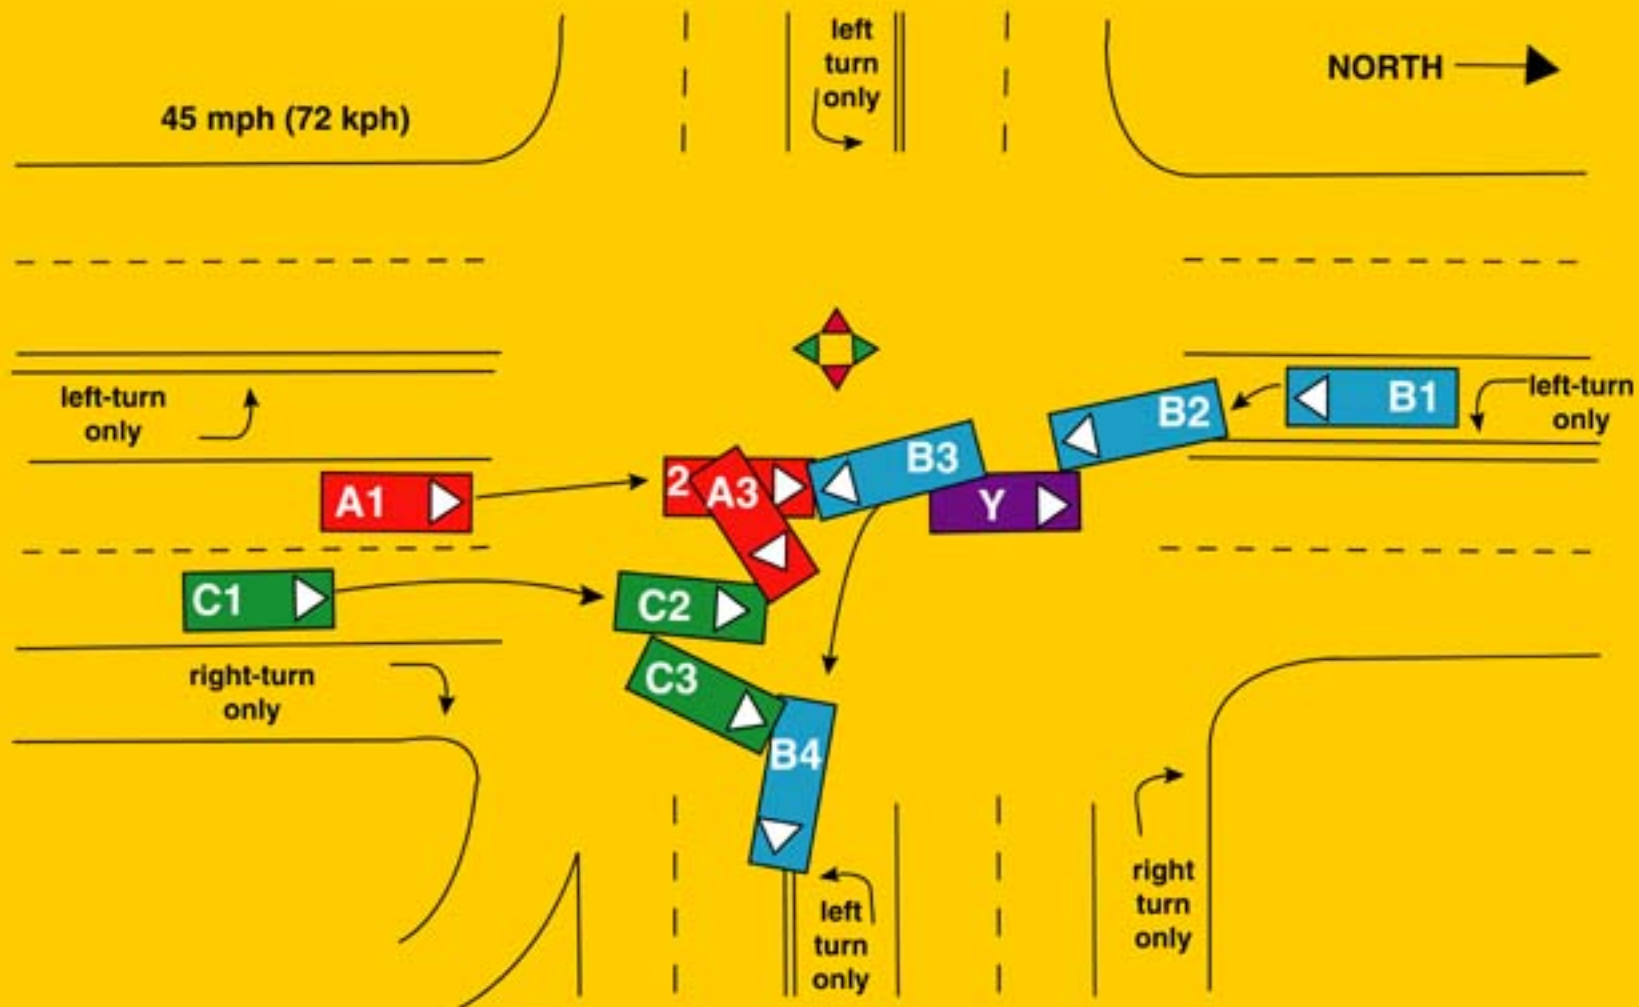

# Vehicle Report

## General

## Conditions

Variable Number and Name	Code Value	Code Description	Other Options
V206 — Urban/Rural Area	1	Urban	<a href="#">more</a>
V207 — Limited Access Highway	0	No	<a href="#">more</a>
V208 — Road Total Lanes	4	4 lanes or more	<a href="#">more</a>
V209 — Intersecting Road Total Lanes	4	4 lanes or more	<a href="#">more</a>
V210 — Road Surface Type	1	Asphalt	<a href="#">more</a>
V211 — Road Defects	0	No	<a href="#">more</a>
V212 — Construction Zone	0	No	<a href="#">more</a>
V213 — Road Alignment Vertical Plane	1	Level	<a href="#">more</a>
V214 — Road Alignment Horizontal Plane	1	Straight	<a href="#">more</a>
V215 — Surface Covering	10	Dry	<a href="#">more</a>
V216 — Visibility Limitation	0	None	<a href="#">more</a>
V217 — Visibility Obstruction	0	None	<a href="#">more</a>
V218 — Speed Limit	4	71-79 km/h .. 45 mph	<a href="#">more</a>
V219 — Precipitation Type	0	None	<a href="#">more</a>
V220 — Precipitation Rate	8	Not applicable	<a href="#">more</a>
V221 — Temperature	9	Unknown	<a href="#">more</a>
V222 — Crosswind	9	Unknown	<a href="#">more</a>
V223 — Light Conditions	1	Daylight	<a href="#">more</a>
V224 — Mechanical Malfunction Mention	0	No	<a href="#">more</a>
V225 — Case Vehicle and Object	0	No	<a href="#">more</a>
V226 — Case Vehicle Rollover	0	No	<a href="#">more</a>
V227 — Case Vehicle Ran Off Roadway	0	No	<a href="#">more</a>
V228 — Moving Case Vehicle/Contacted Moving Vehicle	1	Yes	<a href="#">more</a>

V229 — Case Vehicle/Contacted Stopped Vehicle	0	No	<a href="#">more</a>
V230 — Stopped Case Vehicle/Contactd Vehicle	0	No	<a href="#">more</a>
V231 — Total Vehicles Hit By Case Vehicle	2	2 vehicles	<a href="#">more</a>
V232 — Any Fire in Crash	0	No	<a href="#">more</a>
V233 — Max Police Severity-PAR	7	Non-Fatal Injury, Severity Unknown	<a href="#">more</a>
V234 — Driver Alcohol Involvement	0	Had not been drinking	<a href="#">more</a>
V235 — Driver Alcohol BAC	80	Not tested	<a href="#">more</a>
V236 — Driver Impairment Mention	0	No	<a href="#">more</a>
V237 — Driven/Towed From Scene	2	Towed Due to Damage	<a href="#">more</a>

## Other Vehicle

Variable Number and Name	Code Value	Code Description	Other Options
V301 — Other Vehicle VIN	2FTDF0720VC A	—	—
V302 — Other Vehicle Manufacturer/Body Code	22112	—	—
V303 — Other Vehicle Manufacturer	221	Ford/Canada	<a href="#">more</a>
V304 — Other Vehicle Body Code	12	Pickup truck (no canopy or shell)	<a href="#">more</a>
V305 — Other Vehicle Make/Model	3108	Flareside, Styleside F150	<a href="#">more</a>
V306 — Other Vehicle Model Year	1997	—	—
V307 — Other Vehicle Mass	001848 kg	—	—
V308 — Other Vehicle Number	0	No separate report	<a href="#">more</a>
V309 — Other Vehicle Number of Occupants	01	—	—
V310 — Other Vehicle Traveling Speed	999	Unknown	<a href="#">more</a>
V311 — Highest Police Injury Severity	7	Non-Fatal Injury, Severity Unknown	<a href="#">more</a>
V312 — Other Vehicle Type	12	Pickup truck	<a href="#">more</a>
V313 — Other Vehicle Wheelbase (cm)	305 cm	—	—
V314 — Average Track Width	165 cm	—	—
V315 — Overall Length	513 cm	—	—
V316 — Overall Width (OAW)	192 cm	—	—
V317 — Front Overhang (FOH)	100 cm	—	—
V318 — Rear Overhang (ROH)	110 cm	—	—
V319 — Undeformed End Width (UEW)	180 cm	—	—
V320 — Engine Displacement	4.2 l	—	—
V321 — Engine: Number of Cylinders	06	—	—
V322 — Direct Damage Length (DDL)	180 cm	—	—
V323 — Front-End Overlap % (FEO)	98	98% or more	<a href="#">more</a>
V324 — Vehicle Overlap % (VOL)	98	98% or more	<a href="#">more</a>

## Case Vehicle

### General

Variable Number and Name	Code Value	Code Description	Other Options
V401 — VIN	1FAFP53S9XG2	—	—
V402 — Manufacturer/Body Code	12128	—	—
V403 — Vehicle Manufacturer	121	Ford	<a href="#">more</a>
V404 — Vehicle Body Code	28	—	—
V405 — Make/Model Code	0275	Taurus	<a href="#">more</a>
V406 — Model Year	1999	—	—
V407 — Vehicle Mass	001468 kg	—	—
V408 — Odometer Reading	999999	Unknown	<a href="#">more</a>
V409 — Number of Occupants	02	—	—
V410 — Traveling Speed	999	Unknown	<a href="#">more</a>
V411 — Body Type	14	4-door sedan	<a href="#">more</a>
V412 — Stolen Vehicle	8	Not currently collected	<a href="#">more</a>
V413 — Body Structure	2	Unitized	<a href="#">more</a>
V414 — Transmission Type	1	Automatic	<a href="#">more</a>
V415 — Transmission Lever Location	3	Column	<a href="#">more</a>
V416 — Steering	1	Power	<a href="#">more</a>
V417 — Brakes	1	Power	<a href="#">more</a>
V418 — Brake Type	2	Disc - front wheels	<a href="#">more</a>
V419 — Brake Anti-lock Device	2	Four-wheel	<a href="#">more</a>
V420 — Air Conditioning in Vehicle	8	Not currently collected	<a href="#">more</a>
V421 — Drive Type	2	Front wheel	<a href="#">more</a>
V422 — Dual Rear Wheels	0	No	<a href="#">more</a>
V423 — Original Restraint System Type	3	Airbag	<a href="#">more</a>

V424 — Equipped With Roll Bar	0	No	<a href="#">more</a>
V425 — Roof Type	1	Solid	<a href="#">more</a>
V426 — Wheelbase	276 cm	—	—
V427 — Anti-lacerative Glass	0	None	<a href="#">more</a>
V428 — Average Track Width	157 cm	—	—
V429 — Overall Length	502 cm	—	—
V430 — Overall Width (OAW)	190 cm	—	—
V431 — Front Overhang	106 cm	—	—
V432 — Rear Overhang	120 cm	—	—
V433 — Undeformed End Width (UEW)	148 cm	—	—
V434 — Engine Displacement	3.0 <i>l</i>	—	—
V435 — Engine: Number of Cylinders	06	—	—
V436 — Direct Damage Length (DDL)	148 cm	—	—
V437 — Front End Overlap % (FEO)	98	98% or more	<a href="#">more</a>
V438 — Vehicle Overlap % (VOL)	98	98% or more	<a href="#">more</a>

## Case Vehicle

## Damage

## Description

Variable Number and Name	Code Value	Code Description	Other Options
V501 — Maximum Crush - Front	064 cm	—	—
V502 — Maximum Crush - Right Side	016 cm	—	—
V503 — Maximum Crush - Rear	000 cm	No crush (or less than 1 cm.)	<a href="#">more</a>
V504 — Maximum Crush - Left Side	000 cm	No crush (or less than 1 cm.)	<a href="#">more</a>
V505 — Maximum Crush - Roof	000 cm	No crush (or less than 1 cm.)	<a href="#">more</a>
V506 — Maximum Crush - Other	000 cm	No crush (or less than 1 cm.)	<a href="#">more</a>
V507 — Are Events In Chronological Order	1	Yes	<a href="#">more</a>
V508 — Event 1 Impact Location	1	On Roadway	<a href="#">more</a>
V509 — Event 1 Impact Configuration	11	FRONT of case veh - FRONT of contacted Vehicle	<a href="#">more</a>
V510 — Event 1 Object/Vehicle Contacted	12	Pickup truck	<a href="#">more</a>
V511 — Event 2 Impact Location	1	—	—
V512 — Event 2 Impact Configuration	42	RIGHT of case veh - FRONT of contacted veh (type L)	<a href="#">more</a>
V513 — Event 2 Object/Vehicle Contacted	29	Full 110-114.9 in. wb.	<a href="#">more</a>
V514 — Event 3 Impact Location	8	No 3rd event	<a href="#">more</a>
V515 — Event 3 Impact Configuration	88	No 3rd event	<a href="#">more</a>
V516 — Event 3 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V517 — Event 4 Impact Location	8	No 4th event	<a href="#">more</a>
V518 — Event 4 Impact Configuration	88	No 4th event	<a href="#">more</a>
V519 — Event 4 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>



V520 — Event 5 Impact Location	8	No 5th event	<a href="#">more</a>
V521 — Event 5 Impact Configuration	88	No 5th event	<a href="#">more</a>
V522 — Event 5 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V523 — Event 6 Impact Location	8	No 6th event	<a href="#">more</a>
V524 — Event 6 Impact Configuration	88	No 6th event	<a href="#">more</a>
V525 — Event 6 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V526 — Event 7 Impact On Road	8	No 7th event	<a href="#">more</a>
V527 — Event 7 Impact Configuration	88	No 7th event	<a href="#">more</a>
V528 — Event 7 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V529 — Primary CDC Case Vehicle -event Number	1	Event 1	<a href="#">more</a>
V530 — Primary CDC Case Vehicle - impact speed	999	Unknown	<a href="#">more</a>
V531 — Primary CDC Case Vehicle - Estimated By	1	Investigator	<a href="#">more</a>
V532 — Primary CDC Case Vehicle -crush	064	—	—
V533 — Primary CDC Case Vehicle -clock #1	12	12 o'clock	<a href="#">more</a>
V534 — Primary CDC Case Vehicle letter 1 #1	06	F - Front	<a href="#">more</a>
V535 — Primary CDC Case Vehicle letter 2 #1	04	D - Distributed (Side or End)	<a href="#">more</a>
V536 — Primary CDC Case Vehicle letter 3 #1	05	E - Everything below belt line	<a href="#">more</a>
V537 — Primary CDC Case Vehicle letter 4 #1	23	W - Wide impact area	<a href="#">more</a>
V538 — Primary CDC Case Vehicle Extent #1	03	Extent 3	<a href="#">more</a>
V539 — Primary CDC Case Vehicle -CDC #1	12FDEW3	—	—
V541 — Primary CDC Case Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V542 — Primary CDC Case	00	Missing Data/Not applicable	<a href="#">more</a>

Vehicle letter 2 #2			
V543 — Primary CDC Case Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V544 — Primary CDC Case Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V545 — Primary CDC Case Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>
V546 — Primary CDC Case Vehicle -CDC #2	9800000	—	—
V547 — Primary CDC Contacted Vehicle - Impact Speed	999	Unknown	<a href="#">more</a>
V548 — Primary CDC Contacted Vehicle - Estimated By	1	Investigator	<a href="#">more</a>
V549 — Primary CDC Contacted Vehicle -crush	057	—	—
V550 — Primary CDC Contacted Vehicle -clock #1	12	12 o'clock	<a href="#">more</a>
V551 — Primary CDC Contacted Vehicle letter 1 #1	06	F - Front	<a href="#">more</a>
V552 — Primary CDC Contacted Vehicle letter 2 #1	04	D - Distributed (Side or End) or (F + P + B)	<a href="#">more</a>
V553 — Primary CDC Contacted Vehicle letter 3 #1	05	E - Everything below belt line	<a href="#">more</a>
V554 — Primary CDC Contacted Vehicle letter 4 #1	23	W - Wide impact area	<a href="#">more</a>
V555 — Primary CDC Contacted Vehicle Extent #1	03	Extent 3	<a href="#">more</a>
V556 — Primary CDC Contacted Vehicle -CDC #1	12FDEW3	—	—
V558 — Primary CDC Contacted Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V559 — Primary CDC Contacted Vehicle letter 2 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V560 — Primary CDC Contacted Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V561 — Primary CDC Contacted Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V562 — Primary CDC Contacted Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>
V563 — Primary CDC Contacted Vehicle -CDC #2	9800000	—	—

V564 — Secondary CDC Case Vehicle - Event No	2	Event 1	<a href="#">more</a>
V565 — Secondary CDC Case Vehicle - Impact Speed	999	Unknown	<a href="#">more</a>
V566 — Secondary CDC Case Vehicle - Estimated By	1	—	—
V567 — Secondary CDC Case Vehicle -crush	016	—	—
V568 — Secondary CDC Case Vehicle -clock #1	03	3 o'clock	<a href="#">more</a>
V569 — Secondary CDC Case Vehicle letter 1 #1	18	R - Right Side	<a href="#">more</a>
V570 — Secondary CDC Case Vehicle letter 2 #1	06	F - Side Front (Left or Right)	<a href="#">more</a>
V571 — Secondary CDC Case Vehicle letter 3 #1	05	E - Everything below belt line	<a href="#">more</a>
V572 — Secondary CDC Case Vehicle letter 4 #1	23	W - Wide impact area	<a href="#">more</a>
V573 — Secondary CDC Case Vehicle Extent #1	02	Extent 2	<a href="#">more</a>
V574 — Secondary CDC Case Vehicle -CDC #1	03RFEW2	—	—
V576 — Secondary CDC Case Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V577 — Secondary CDC Case Vehicle letter 2 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V578 — Secondary CDC Case Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V579 — Secondary CDC Case Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V580 — Secondary CDC Case Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>
V581 — Secondary CDC Case Vehicle -CDC #2	9800000	—	—
V582 — Secondary CDC Contacted Vehicle - Impact Speed	999	Unknown	<a href="#">more</a>
V583 — Secondary CDC Contacted Vehicle - Estimated By	1	—	—
V584 — Secondary CDC Contacted Vehicle -crush	043	—	—
V585 — Secondary CDC Contacted Vehicle -clock #1	12	12 o'clock	<a href="#">more</a>

V586 — Secondary CDC Contacted Vehicle letter 1 #1	06	F - Front	<a href="#">more</a>
V587 — Secondary CDC Contacted Vehicle letter 2 #1	25	Y - Side or end (F + P or L + C)	<a href="#">more</a>
V588 — Secondary CDC Contacted Vehicle letter 3 #1	05	E - Everything below belt line	<a href="#">more</a>
V589 — Secondary CDC Contacted Vehicle letter 4 #1	23	W - Wide impact area	<a href="#">more</a>
V590 — Secondary CDC Contacted Vehicle Extent #1	02	Extent 2	<a href="#">more</a>
V591 — Secondary CDC Contacted Vehicle -CDC #1	12FYEW2	—	—
V593 — Secondary CDC Contacted Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V594 — Secondary CDC Contacted Vehicle letter 2 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V595 — Secondary CDC Contacted Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V596 — Secondary CDC Contacted Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V597 — Secondary CDC Contacted Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>
V598 — Secondary CDC Contacted Vehicle -CDC #2	9800000	—	—

## Crash Severity

Variable Number and Name	Code Value	Code Description	Other Options
V601 — Case Vehicle Primary Impact Number	1	—	—
V602 — Primary Impact Total Delta-V	999	Unknown	<a href="#">more</a>
V603 — Primary Case Vehicle Reconstructed Longitudinal Delta-V	9999	—	—
V604 — Primary Case Vehicle Reconstructed Lateral Delta-V	9999	—	—
V605 — Primary Case Vehicle Reconstructed Crush Energy	9999	—	—
V606 — Primary Impact Case Vehicle - reconstruction	02	Insufficient data	<a href="#">more</a>
V607 — Primary Case Vehicle Reconstruction Mode	5	Not reconstructed	<a href="#">more</a>
V608 — Primary Contacted Vehicle Reconstructed Total Delta-V	999	Unknown	<a href="#">more</a>
V609 — Primary Contacted Vehicle Reconstructed Longitudinal Delta-V	9999	—	—
V610 — Primary Contacted Vehicle Reconstructed Lateral Delta-V	9999	—	—
V611 — Primary Contacted Vehicle Reconstructed Crush Energy	9999	—	—
V612 — Case Vehicle Secondary Impact Number	2	—	—
V613 — Secondary Case Vehicle Reconstructed Total Delta-V	999	Unknown	<a href="#">more</a>
V614 — Secondary Case Vehicle Reconstructed Longitudinal Delta-V	9999	—	—
V615 — Secondary Case Vehicle Reconstructed Lateral Delta-V	9999	—	—
V616 — Secondary Case Vehicle Reconstructed Crush Energy	9999	—	—
V617 — Secondary Case Vehicle Reconstruction Note	02	Insufficient data	<a href="#">more</a>
V618 — Secondary Case Vehicle Reconstruction Mode	5	Not reconstructed	<a href="#">more</a>
V619 — Secondary Contacted Vehicle	999	Unknown	<a href="#">more</a>

Reconstructed Total Delta-V			
V620 — Secondary Contacted Vehicle Reconstructed Longitudinal Delta-V	9999	—	—
V621 — Secondary Contacted Vehicle Reconstructed Lateral Delta-V	9999	—	—
V622 — Secondary Contacted Vehicle Reconstructed Crush Energy	9999	—	—
V623 — Case Vehicle Primary Impact Number	1	—	—
V624 — Primary Case Vehicle Reconstructed Total EBS	040 kph	—	—
V625 — Primary Case Vehicle Reconstructed Longitudinal EBS	-038 kph	—	—
V626 — Primary Case Vehicle Reconstructed Lateral EBS	0010 kph	—	—
V627 — Primary Case Vehicle Reconstructed Crush Energy	0111 kJ	—	—
V628 — Primary Case Vehicle Reconstruction Note	22	Reconstructed, moderate confidence level	<a href="#">more</a>
V629 — Primary Case Vehicle Reconstruction Mode	2	CDC & detailed damage	<a href="#">more</a>
V630 — Primary Contacted Vehicle Reconstruction Total EBS	999	Unknown	<a href="#">more</a>
V631 — Primary Contacted Vehicle Reconstruction Longitudinal EBS	9999	—	—
V632 — Primary Contacted Vehicle Reconstruction Lateral EBS	9999	—	—
V633 — Primary Contacted Vehicle Reconstruction Crush Energy	9999	—	—
V634 — Case Vehicle Secondary Impact Number	2	—	—
V635 — Secondary Case Vehicle Reconstruction Total EBS	999	Unknown	<a href="#">more</a>
V636 — Secondary Case Vehicle Reconstruction Longitudinal EBS	9999	—	—
V637 — Secondary Case Vehicle Reconstruction Lateral EBS	9999	—	—
V638 — Secondary Case Vehicle Reconstruction Crush Energy	9999	—	—
V639 — Secondary Case Vehicle Reconstruction Note	02	Insufficient data	<a href="#">more</a>

V640 — Secondary Case Vehicle Reconstruction Mode	5	Not reconstructed	<a href="#">more</a>
V641 — Secondary Contacted Vehicle Reconstruction Total EBS	999	Unknown	<a href="#">more</a>
V642 — Secondary Contacted Vehicle Reconstruction Longitudinal EBS	9999	—	—
V643 — Secondary Contacted Vehicle Reconstruction Lateral EBS	9999	—	—
V644 — Secondary Contacted Vehicle Reconstruction Crush Energy	9999	—	—
V645 — Case Vehicle Reconstructed Impact Number	1	—	—
V646 — Case Vehicle Impact 1 Plane	1	Bumper	<a href="#">more</a>
V647 — Case Vehicle Impact 1 Direct Damage Length [DDL]	148 cm	—	—
V648 — Case Vehicle Impact 1 Max Crush	064 cm	—	—
V649 — Case Vehicle Impact 1 Field-L	107 cm	—	—
V650 — Case Vehicle Impact 1 C1	020 cm	—	—
V651 — Case Vehicle Impact 1 C2	048 cm	—	—
V652 — Case Vehicle Impact 1 C3	059 cm	—	—
V653 — Case Vehicle Impact 1 C4	040 cm	—	—
V654 — Case Vehicle Impact 1 C5	021 cm	—	—
V655 — Case Vehicle Impact 1 C6	015 cm	—	—
V656 — Case Vehicle Impact 1 +/- D	0000 cm	—	—
V657 — Case Vehicle Reconstructed Impact Number	2	—	—
V658 — Case Vehicle Impact 2 Plane	4	Above sill	<a href="#">more</a>
V659 — Case Vehicle Impact 2 Direct Damage Length [DDL]	102 cm	—	—
V660 — Case Vehicle Impact 2 Max Crush	016 cm	—	—
V661 — Case Vehicle Impact 2 Field-L	999	Unknown	<a href="#">more</a>
V662 — Case Vehicle Impact 2 C1	999	Unknown	<a href="#">more</a>
V663 — Case Vehicle Impact 2 C2	999	Unknown	<a href="#">more</a>
V664 — Case Vehicle Impact 2 C3	999	Unknown	<a href="#">more</a>
V665 — Case Vehicle Impact 2 C4	999	Unknown	<a href="#">more</a>



V666 — Case Vehicle Impact 2 C5	999	Unknown	<a href="#">more</a>
V667 — Case Vehicle Impact 2 C6	999	Unknown	<a href="#">more</a>
V668 — Case Vehicle Impact 2 +/- D	0999 cm	—	—
V669 — Other Vehicle Reconstructed Impact Number	1	—	—
V670 — Other Vehicle Impact 1 Plane	1	Bumper	<a href="#">more</a>
V671 — Other Vehicle Impact 1 Direct Damage Length [DDL]	180 cm	—	—
V672 — Other Vehicle Impact 1 Max Crush	057 cm	—	—
V673 — Other Vehicle Impact 1 Field-L	999	Unknown	<a href="#">more</a>
V674 — Other Vehicle Impact 1 C1	999	Unknown	<a href="#">more</a>
V675 — Other Vehicle Impact 1 C2	999	Unknown	<a href="#">more</a>
V676 — Other Vehicle Impact 1 C3	999	Unknown	<a href="#">more</a>
V677 — Other Vehicle Impact 1 C4	999	Unknown	<a href="#">more</a>
V678 — Other Vehicle Impact 1 C5	999	Unknown	<a href="#">more</a>
V679 — Other Vehicle Impact 1 C6	999	Unknown	<a href="#">more</a>
V680 — Other Vehicle Impact 1 +/- D	0999 cm	—	—
V681 — Other Vehicle Reconstructed Impact Number	2	—	—
V682 — Other Vehicle Impact 2 Plane	8	Not applicable	<a href="#">more</a>
V683 — Other Vehicle Impact 2 Direct Damage Length [DDL]	998	Not applicable	<a href="#">more</a>
V684 — Other Vehicle Impact 2 Max Crush	998	Not applicable	<a href="#">more</a>
V685 — Other Vehicle Impact 2 Field-L	998	Not applicable	<a href="#">more</a>
V686 — Other Vehicle Impact 2 C1	998	Not applicable	<a href="#">more</a>
V687 — Other Vehicle Impact 2 C2	998	Not applicable	<a href="#">more</a>
V688 — Other Vehicle Impact 2 C3	998	Not applicable	<a href="#">more</a>
V689 — Other Vehicle Impact 2 C4	998	Not applicable	<a href="#">more</a>
V690 — Other Vehicle Impact 2 C5	998	Not applicable	<a href="#">more</a>
V691 — Other Vehicle Impact 2 C6	998	Not applicable	<a href="#">more</a>
V692 — Other Vehicle Impact 2 +/- D	9998	—	—

## Case Vehicle

### Tires & Rims

Variable Number and Name	Code Value	Code Description	Other Options
V701 — Left Front Wheel Damaged	1	Yes	<a href="#">more</a>
V702 — Right Front Wheel Damaged	1	Yes	<a href="#">more</a>
V703 — Right Rear Wheel Damaged	0	No	<a href="#">more</a>
V704 — Left Rear Wheel Damaged	0	No	<a href="#">more</a>
V705 — Left Front Tire Tread Type	4	All Weather	<a href="#">more</a>
V706 — Right Front Tire Tread Type	4	All Weather	<a href="#">more</a>
V707 — Right Rear Tire Tread Type	4	All Weather	<a href="#">more</a>
V708 — Left Rear Tire Tread Type	4	All Weather	<a href="#">more</a>
V709 — Left Front Carcass Construction	3	Radial	<a href="#">more</a>
V710 — Right Front Carcass Construction	3	Radial	<a href="#">more</a>
V711 — Right Rear Carcass Construction	3	Radial	<a href="#">more</a>
V712 — Left Rear Carcass Construction	3	Radial	<a href="#">more</a>
V717 — Left Front Tire Size	9999999999	—	—
V718 — Right Front Tire Size	9999999999	—	—
V719 — Right Rear Tire Size	9999999999	—	—
V720 — Left Rear Tire Size	9999999999	—	—

## Case Vehicle

### Fuel, Tank, Fire

Variable Number and Name	Code Value	Code Description	Other Options
V801 — Propulsive Fuel Type	1	Gasoline	<a href="#">more</a>
V802 — Main Tank Location	322	Within frame/centered laterally - within vertically	<a href="#">more</a>
V803 — Main Filler Cap Location	133	—	—
V804 — Main Tank Material	3	Plastic	<a href="#">more</a>
V805 — Aux Tank Type	8	Not applicable (not equipped)	<a href="#">more</a>
V806 — Aux Tank Location	888	Not applicable (not equipped)	<a href="#">more</a>
V807 — Aux Filler Cap Location	888	Not applicable (not equipped)	<a href="#">more</a>
V808 — Aux Tank Material	8	Not applicable	<a href="#">more</a>
V901 — Fuel Leakage From Crash	0	No	<a href="#">more</a>
V1001 — Fire In Or On Case Vehicle	0	No	<a href="#">more</a>

## Case Vehicle

### Exterior

Variable Number and Name	Code Value	Code Description	Other Options
V1101 — Hood Latch Released	0	No	<a href="#">more</a>
V1102 — Hood Latch Damaged	1	Yes	<a href="#">more</a>
V1103 — Hood Latch Jammed	1	Yes	<a href="#">more</a>
V1104 — Left Hood Hinge Damaged	1	Yes	<a href="#">more</a>
V1105 — Left Hood Hinge Separated	0	No	<a href="#">more</a>
V1106 — Right Hood Hinge Damaged	1	Yes	<a href="#">more</a>
V1107 — Right Hood Hinge Separated	0	No	<a href="#">more</a>
V1108 — Hood Remained On Vehicle	1	Yes	<a href="#">more</a>
V1109 — Rear Hood Edge Elevated	1	Yes	<a href="#">more</a>
V1110 — Edge Contacted Windshield	0	No	<a href="#">more</a>
V1111 — Edge Penetrated Windshield	8	Not applicable	<a href="#">more</a>
V1112 — Hood Latch Location	1	Front of Vehicle	<a href="#">more</a>
V1113 — Eng/Transmissn Mount Separation	0	No	<a href="#">more</a>
V1114 — Steerng Column Flex Coupling	9	Unknown if equipped	<a href="#">more</a>
V1115 — Steerng Column Coupling Damaged	9	Unknown	<a href="#">more</a>
V1116 — Steerng Column Coupling Separated	9	Unknown	<a href="#">more</a>
V1117 — Eng Comp Telescopng Unit	88	Not collected	<a href="#">more</a>
V1118 — Comp Orig/Telescopd Diff	888	Not collected	<a href="#">more</a>
V1119 — Left Side Body Mount Separation	8	Not applicable (unitized)	<a href="#">more</a>

V1120 — Upper Left A-pillar Separation	0	No	<a href="#">more</a>
V1121 — Lower Left A-pillar Separation	0	No	<a href="#">more</a>
V1122 — Upper Left B-pillar Separation	0	No	<a href="#">more</a>
V1123 — Lower Left B-pillar Separation	0	No	<a href="#">more</a>
V1124 — Upper Left C-pillar Separation	0	No	<a href="#">more</a>
V1125 — Lower Left C-pillar Separation	0	No	<a href="#">more</a>
V1126 — Upper Left D-pillar Separation	8	Not applicable (not equipped)	<a href="#">more</a>
V1127 — Lower Left D-pillar Separation	8	Not applicable (not equipped)	<a href="#">more</a>
V1128 — Left Front Door Opening Cause	0	Door did not open	<a href="#">more</a>
V1129 — Left Rear Door Opening Cause	0	Door did not open	<a href="#">more</a>
V1130 — Left Front Door Jammed Closed	0	No	<a href="#">more</a>
V1131 — Left Rear Door Jammed Closed	0	No	<a href="#">more</a>
V1132 — Rear Door Type	0	No door (includes pickups)	<a href="#">more</a>
V1133 — Rear Door Opening Cause	8	Not applicable (no rear door)	<a href="#">more</a>
V1134 — Rear Door Jammed Closed	8	Not applicable (no rear door)	<a href="#">more</a>
V1135 — Luggage Partition Damagd	8	Not applicable	<a href="#">more</a>
V1136 — Spare Tire Status	8	Not collected	<a href="#">more</a>
V1137 — Trailer Hitch Type	0	No hitch	<a href="#">more</a>
V1138 — Trailer Type	0	No trailer	<a href="#">more</a>
V1139 — Right Side Body Mount Separation	8	Not applicable (unitized)	<a href="#">more</a>
V1140 — Upper Right A-pillar Separation	0	No	<a href="#">more</a>
V1141 — Lower Right A-pillar Separation	0	No	<a href="#">more</a>

V1142 — Upper Right B-pillar Separation	0	No	<a href="#">more</a>
V1143 — Lower Right B-pillar Separation	0	No	<a href="#">more</a>
V1144 — Upper Right C-pillar Separation	0	No	<a href="#">more</a>
V1145 — Lower Right C-pillar Separation	0	No	<a href="#">more</a>
V1146 — Upper Right D-pillar Separation	8	Not applicable (not equipped)	<a href="#">more</a>
V1147 — Lower Right D-pillar Separation	8	Not applicable (not equipped)	<a href="#">more</a>
V1148 — Right Front Door Opening Cause	00	Door did not open	<a href="#">more</a>
V1149 — Right Rear Door Opening Cause	00	Door did not open	<a href="#">more</a>
V1150 — Right Front Door Jammed Closed	0	No	<a href="#">more</a>
V1151 — Right Rear Door Jammed Closed	0	No	<a href="#">more</a>
V1152 — Van Rear Door Type	8	Not applicable (not a van)	<a href="#">more</a>
V1153 — Windshield Cracked		Yes	<a href="#">more</a>
V1154 — Windshield Broken	0	No	<a href="#">more</a>
V1155 — Windshield Cracked or Broken by Occupant	0	No	<a href="#">more</a>
V1156 — Bond Separation Extent	0	None	<a href="#">more</a>
V1157 — Windshield Code		—	—
V1158 — Did Sun/T Roof Open	8	Not Applicable	<a href="#">more</a>

## Case Vehicle

### Steering

#### Column/Rim

Variable Number and Name	Code Value	Code Description	Other Options
V1201 — Steering Wheel Rim Damage	0	None	<a href="#">more</a>
V1202 — Number of Steering Wheel Spokes	4	4 spokes	<a href="#">more</a>
V1203 — Steering Wheel Spoke Damage	0	None	<a href="#">more</a>
V1204 — Column Tilt Feature	1	Yes, equipped (position unknown)	<a href="#">more</a>
V1205 — Column Swing-away Feature	0	Not equipped	<a href="#">more</a>
V1206 — Column Telescoping Feature	0	Not equipped	<a href="#">more</a>
V1207 — Wheel Energy Absorb Device	8	Not collected	<a href="#">more</a>
V1208 — Wheel Ea Orig/Damaged Diff	888	Not collected	<a href="#">more</a>
V1209 — Column Energy Absorb Device	88	Not collected	<a href="#">more</a>
V1210 — Column Ea Orig/Comprss Diff	888	Not collected	<a href="#">more</a>
V1211 — Shear Capsule Separation	888	Not collected	<a href="#">more</a>
V1212 — Column Vertical Rotation	0	No apparent rotation	<a href="#">more</a>
V1213 — Column Lateral Rotation	0	No apparent rotation	<a href="#">more</a>
V1214 — Steering Wheel Hub Damage	0	None	<a href="#">more</a>



## Case Vehicle

### Intrusion

Variable Number and Name	Code Value	Code Description	Other Options
V1301 — Occupant Compartment Intrusion	0	No	<a href="#">more</a>
V1302 — Was Intrusion Catastrophic	8	Not applicable	<a href="#">more</a>
V1303 — Intrusion Number 01	00	No Intrusion, None	<a href="#">more</a>
V1304 — Intrusion 01 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1305 — Intrusion 01 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1306 — Intrusion 01 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1307 — Intrusion 01 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1308 — Intrusion 01 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1309 — Intrusion 01 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1310 — Intrusion 01 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1311 — Intrusion 01 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1312 — Intrusion 01 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1313 — Intrusion 01 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1314 — Intrusion Number 02	00	No Intrusion, None	<a href="#">more</a>
V1315 — Intrusion 02 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1316 — Intrusion 02 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1317 — Intrusion 02 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1318 — Intrusion 02 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1319 — Intrusion 02 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>

V1320 — Intrusion 02 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1321 — Intrusion 02 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1322 — Intrusion 02 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1323 — Intrusion 02 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1324 — Intrusion 02 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1325 — Intrusion Number 03	00	No Intrusion, None	<a href="#">more</a>
V1326 — Intrusion 03 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1327 — Intrusion 03 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1328 — Intrusion 03 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1329 — Intrusion 03 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1330 — Intrusion 03 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1331 — Intrusion 03 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1332 — Intrusion 03 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1333 — Intrusion 03 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1334 — Intrusion 03 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1335 — Intrusion 03 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1336 — Intrusion Number 04	00	No Intrusion, None	<a href="#">more</a>
V1337 — Intrusion 04 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1338 — Intrusion 04 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1339 — Intrusion 04 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1340 — Intrusion 04 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1341 — Intrusion 04 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1342 — Intrusion 04 Max Intrusion Z-	00 cm	0 cm or No Intrusion	<a href="#">more</a>

axis			
V1343 — Intrusion 04 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1344 — Intrusion 04 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1345 — Intrusion 04 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1346 — Intrusion 04 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1347 — Intrusion Number 05	00	No Intrusion, None	<a href="#">more</a>
V1348 — Intrusion 05 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1349 — Intrusion 05 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1350 — Intrusion 05 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1351 — Intrusion 05 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1352 — Intrusion 05 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1353 — Intrusion 05 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1354 — Intrusion 05 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1355 — Intrusion 05 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1356 — Intrusion 05 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1357 — Intrusion 05 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1358 — Intrusion Number 06	00	No Intrusion, None	<a href="#">more</a>
V1359 — Intrusion 06 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1360 — Intrusion 06 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1361 — Intrusion 06 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1362 — Intrusion 06 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1363 — Intrusion 06 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1364 — Intrusion 06 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>

V1365 — Intrusion 06 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1366 — Intrusion 06 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1367 — Intrusion 06 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1368 — Intrusion 06 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1369 — Intrusion Number 07	00	No Intrusion, None	<a href="#">more</a>
V1370 — Intrusion 07 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1371 — Intrusion 07 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1372 — Intrusion 07 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1373 — Intrusion 07 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1374 — Intrusion 07 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1375 — Intrusion 07 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1376 — Intrusion 07 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1377 — Intrusion 07 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1378 — Intrusion 07 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1379 — Intrusion 07 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1380 — Intrusion Number 08	00	No Intrusion, None	<a href="#">more</a>
V1381 — Intrusion 08 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1382 — Intrusion 08 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1383 — Intrusion 08 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1384 — Intrusion 08 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1385 — Intrusion 08 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1386 — Intrusion 08 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1387 — Intrusion 08 Occupant Number	00	No contact or no	<a href="#">more</a>

		intrusion	
V1388 — Intrusion 08 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1389 — Intrusion 08 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1390 — Intrusion 08 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1391 — Intrusion Number 09	00	No Intrusion, None	<a href="#">more</a>
V1392 — Intrusion 09 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1393 — Intrusion 09 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1394 — Intrusion 09 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1395 — Intrusion 09 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1396 — Intrusion 09 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1397 — Intrusion 09 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1398 — Intrusion 09 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1399 — Intrusion 09 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1400 — Intrusion 09 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1401 — Intrusion 09 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1402 — Intrusion Number 10	00	No Intrusion, None	<a href="#">more</a>
V1403 — Intrusion 10 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1404 — Intrusion 10 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1405 — Intrusion 10 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1406 — Intrusion 10 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1407 — Intrusion 10 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1408 — Intrusion 10 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1409 — Intrusion 10 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>

V1410 — Intrusion 10 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1411 — Intrusion 10 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1412 — Intrusion 10 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1413 — Door Intrusion Number 01	88	Not Applicable	<a href="#">more</a>
V1414 — Door Intrusion Number 01 Cause	8	Not applicable	<a href="#">more</a>
V1415 — Door Intrusion Number 02	88	Not Applicable	<a href="#">more</a>
V1416 — Door Intrusion Number 02 Cause	8	Not applicable	<a href="#">more</a>
V1417 — Door Intrusion Number 03	88	Not Applicable	<a href="#">more</a>
V1418 — Door Intrusion Number 03 Cause	8	Not applicable	<a href="#">more</a>
V1419 — Door Intrusion 01 Component	88	Not Applicable	<a href="#">more</a>
V1420 — Door Intrusion 01 Component Damaged 1	8	Not Applicable	<a href="#">more</a>
V1421 — Door Intrusion 01 Component Damaged 2	8	Not Applicable	<a href="#">more</a>
V1422 — Door Intrusion 02 Component	88	Not Applicable	<a href="#">more</a>
V1423 — Door Intrusion 02 Component Damaged 1	8	Not Applicable	<a href="#">more</a>
V1424 — Door Intrusion 02 Component Damaged 2	8	Not Applicable	<a href="#">more</a>
V1425 — Door Intrusion 03 Component	88	Not Applicable	<a href="#">more</a>
V1426 — Door Intrusion 03 Component Damaged 1	8	Not Applicable	<a href="#">more</a>
V1427 — Door Intrusion 03 Component Damaged 2	8	Not Applicable	<a href="#">more</a>
V1428 — Door Intrusion 04 Component	88	Not Applicable	<a href="#">more</a>
V1429 — Door Intrusion 04 Component Damaged 1	8	Not Applicable	<a href="#">more</a>
V1430 — Door Intrusion 04 Component Damaged 2	8	Not Applicable	<a href="#">more</a>

## Case Vehicle

### Airbag(s)

Variable Number and Name	Code Value	Code Description	Other Options
V1501 — Driver Airbag Equipped	1	Yes	<a href="#">more</a>
V1502 — Driver Airbag Deployed	1	Yes	<a href="#">more</a>
V1503 — Driver Airbag Condition	0	No Damage	<a href="#">more</a>
V1504 — Passenger Airbag Equip	1	Yes	<a href="#">more</a>
V1505 — Passenger Airbag Deployed	1	Yes	<a href="#">more</a>
V1506 — Passenger Airbag Condition	0	No Damage	<a href="#">more</a>
V1507 — Steering Wheel Airbag Tether	1	Yes	<a href="#">more</a>
V1508 — Driver Airbag Marked By Contact	1	Yes	<a href="#">more</a>
V1509 — Passenger Airbag Tether	0	No	<a href="#">more</a>
V1510 — Passenger Airbag Marked By Contact	0	No	<a href="#">more</a>



## Case Vehicle

### Interior

Variable Number and Name	Code Value	Code Description	Other Options
V1601 — Left Front Door Damaged	0	No	<a href="#">more</a>
V1602 — Right Front Door Damaged	0	No	<a href="#">more</a>
V1603 — Left Front Hardware Damaged	0	No	<a href="#">more</a>
V1604 — Right Front Hardware Damaged	0	No	<a href="#">more</a>
V1605 — Left Front Armrest Damaged	0	No	<a href="#">more</a>
V1606 — Right Front Armrest Damaged	0	No	<a href="#">more</a>
V1607 — Left Front Glass Damaged	0	No	<a href="#">more</a>
V1608 — Right Front Glass Damaged	0	No	<a href="#">more</a>
V1609 — Left Rear Door Area Damaged	3	No, occupant contact	<a href="#">more</a>
V1610 — Right Rear Door Area Damaged	0	No	<a href="#">more</a>
V1611 — Left Rear Hardware Damaged	0	No	<a href="#">more</a>
V1612 — Right Rear Hardware Damaged	0	No	<a href="#">more</a>
V1613 — Left Rear Armrest Damaged	0	No	<a href="#">more</a>
V1614 — Right Rear Armrest Damaged	0	No	<a href="#">more</a>
V1615 — Left Rear Glass Damaged	0	No	<a href="#">more</a>
V1616 — Right Rear Glass Damaged	0	No	<a href="#">more</a>
V1617 — Left Roof Side Rail Damaged	0	No	<a href="#">more</a>
V1618 — Right Roof Side Rail Damaged	0	No	<a href="#">more</a>
V1619 — Left B-pillar Damaged	3	No, occupant contact	<a href="#">more</a>
V1620 — Right B-pillar Damaged	0	No	<a href="#">more</a>
V1621 — Left C-pillar Damaged	0	No	<a href="#">more</a>
V1622 — Right C-pillar Damaged	0	No	<a href="#">more</a>
V1623 — Left D-pillar Damaged	8	Not applicable	<a href="#">more</a>
V1624 — Right D-pillar Damaged	8	Not applicable	<a href="#">more</a>
V1625 — Left Headlining Damaged	0	No	<a href="#">more</a>
V1626 — Right Headlining Damaged	0	No	<a href="#">more</a>

V1627 — Left Roof Structure Damaged	0	No	<a href="#">more</a>
V1628 — Right Roof Structure Damaged	0	No	<a href="#">more</a>
V1629 — Left T/Sun Roof Damaged	8	Not applicable	<a href="#">more</a>
V1630 — Right T/Sun Roof Damaged	8	Not applicable	<a href="#">more</a>
V1631 — Other Left Side Item Damagd	8	Not applicable	<a href="#">more</a>
V1632 — Other Right Side Item Damagd	8	Not applicable	<a href="#">more</a>
V1633 — Foot Controls Damaged	0	No	<a href="#">more</a>
V1634 — Ignition Key Damaged	0	No	<a href="#">more</a>
V1635 — Rear View Mirror Damaged	0	No	<a href="#">more</a>
V1636 — Sunvisor/Fitting Damaged	0	No	<a href="#">more</a>
V1637 — Windshield Molding Damaged	0	No	<a href="#">more</a>
V1638 — Left A-pillar Damaged	0	No	<a href="#">more</a>
V1639 — Right A-pillar Damaged	0	No	<a href="#">more</a>
V1640 — Center Console Damaged	0	No	<a href="#">more</a>
V1641 — Transmission Lever Damaged	0	No	<a href="#">more</a>
V1642 — Horn/Spoke Shroud Damaged	0	No	<a href="#">more</a>
V1643 — Upper Panel Damaged	0	No	<a href="#">more</a>
V1644 — Mid Panel Damaged	0	No	<a href="#">more</a>
V1645 — Lower Panel Damaged	4	Yes, occupant contact	<a href="#">more</a>
V1646 — Ashtray Damaged	0	No	<a href="#">more</a>
V1647 — Control Knob/Lever Damaged	0	No	<a href="#">more</a>
V1648 — Glove Compartment Area Damaged	0	No	<a href="#">more</a>
V1649 — Instruments Damaged	0	No	<a href="#">more</a>
V1650 — Park Brake Release Damaged	1	Yes	<a href="#">more</a>
V1651 — Park Brake Pedal Damaged	0	No	<a href="#">more</a>
V1652 — A/C Or Upper Vent Damaged	0	No	<a href="#">more</a>
V1653 — Heater Or A/C Duct Damaged	0	No	<a href="#">more</a>
V1654 — Radio Damaged	0	No	<a href="#">more</a>
V1655 — Other Item Damaged	8	Not applicable	<a href="#">more</a>
V1656 — Rear Window Damaged	0	No	<a href="#">more</a>

V1657 — Rear Window Header Damaged	0	No	<a href="#">more</a>
V1658 — Vertical Console Damaged	8	Not applicable	<a href="#">more</a>
V1659 — Roof Console Damaged	8	Not applicable	<a href="#">more</a>

## Case Vehicle



### Seats

Variable Number and Name	Code Value	Code Description	Other Options
V1701 — Driver Front Seat Type	05	Bucket	<a href="#">more</a>
V1702 — Passenger Front Seat Type	05	Bucket	<a href="#">more</a>
V1703 — Driver Seat Mount Type	1	Standard	<a href="#">more</a>
V1704 — Passenger Seat Mount Type	1	Standard	<a href="#">more</a>
V1705 — Driver Swivel Mechanism Equipped	0	No	<a href="#">more</a>
V1706 — Passenger Swivel Mechanism Equipped	0	No	<a href="#">more</a>
V1707 — Driver Seat Original Equipment	1	Yes	<a href="#">more</a>
V1708 — Passenger Seat Original Equipment	1	Yes	<a href="#">more</a>
V1709 — Driver Seat/Rear Occupant Contact	1	Yes	<a href="#">more</a>
V1710 — Passenger Seat/Rear Occupant Contact	8	Not applicable	<a href="#">more</a>
V1711 — Driver Seat Damage	1	Backrest only damaged	<a href="#">more</a>
V1712 — Passenger Seat Damage	0	None	<a href="#">more</a>
V1713 — Center Front Armrest Damaged	0	No	<a href="#">more</a>
V1714 — Driver Seat Rotation	0	None apparent	<a href="#">more</a>
V1715 — Passenger Seat Rotation	0	None apparent	<a href="#">more</a>
V1716 — Driver Seat-back Type	3	Reclining	<a href="#">more</a>
V1717 — Passenger Seat-back Type	3	Reclining	<a href="#">more</a>
V1718 — Driver Seat-back Lock Type	1	Manual	<a href="#">more</a>
V1719 — Passenger Seat-back Lock Type	1	Manual	<a href="#">more</a>
V1720 — Driver Seat-back Lock Held	1	Yes	<a href="#">more</a>
V1721 — Passenger Seat-back Lock Held	1	Yes	<a href="#">more</a>
V1722 — Driver Recliner Mechanism Held	1	Yes	<a href="#">more</a>
V1723 — Passenger Recliner Mechanism Held	1	Yes	<a href="#">more</a>
V1724 — Driver Head Restraint Type	1	Adjustable	<a href="#">more</a>



V1725 — Passenger Head Restraint Type	1	Adjustable	<a href="#">more</a>
V1726 — Driver Head Rest Removed	0	No	<a href="#">more</a>
V1727 — Passenger Head Rest Removed	0	No	<a href="#">more</a>
V1728 — Driver Head Rest Adjustment	2	Down	<a href="#">more</a>
V1729 — Passenger Head Rest Adjustment	2	Down	<a href="#">more</a>
V1730 — Driver Head Rest Damage	0	None	<a href="#">more</a>
V1731 — Passenger Head Rest Damage	0	None	<a href="#">more</a>
V1732 — Driver Seat Adjustment Type	1	Manual	<a href="#">more</a>
V1733 — Passenger Seat Adjustment Type	1	Manual	<a href="#">more</a>
V1734 — Driver Seat Adjustment Provided	1	2-way	<a href="#">more</a>
V1735 — Passenger Seat Adjustment Provided	1	2-way	<a href="#">more</a>
V1736 — Driver Seat Adjuster Damage	0	None	<a href="#">more</a>
V1737 — Passenger Seat Adjuster Damage	0	None	<a href="#">more</a>
V1738 — Driver Seat Adjuster Separation	8	Not applicable	<a href="#">more</a>
V1739 — Passenger Seat Adjuster Separation	8	Not applicable	<a href="#">more</a>
V1740 — Driver Seat Pre-crash Position	9	Unknown	<a href="#">more</a>
V1741 — Passenger Seat Pre-crash Position	3	Rearward	<a href="#">more</a>
V1742 — Left Rear Seat Type	6	Luggage area access panel	<a href="#">more</a>
V1743 — Right Rear Seat Type	6	Luggage area access panel	<a href="#">more</a>
V1744 — Left Rear Seat Damaged	0	None	<a href="#">more</a>
V1745 — Right Rear Seat Damaged	0	None	<a href="#">more</a>
V1746 — Center Rear Armrest Damaged	8	Not applicable (No Center Armrest)	<a href="#">more</a>
V1747 — Left Rear Seat-back Left Lock Equipped	1	Yes	<a href="#">more</a>
V1748 — Right Rear Seat-back Left Lock Equipped	0	No	<a href="#">more</a>
V1749 — Left Rear Seat-back Left Lock Held	1	Yes	<a href="#">more</a>
V1750 — Right Rear Seat-back Left Lock Held	8	Not applicable	<a href="#">more</a>
V1751 — Left Rear Seat-back Right Lock	0	No	<a href="#">more</a>

Equipped			
V1752 — Right Rear Seat-back Right Lock Equipped	1	Yes	<a href="#">more</a>
V1753 — Left Rear Seat-back Right Lock Held	8	Not applicable	<a href="#">more</a>
V1754 — Right Rear Seat-back Right Lock Held	1	Yes	<a href="#">more</a>
V1755 — Left 3rd Seat Equipped	0	No	<a href="#">more</a>
V1756 — Right 3rd Seat Equipped	0	No	<a href="#">more</a>
V1757 — Left 3rd Seat Backrest Damaged	8	Not applicable	<a href="#">more</a>
V1758 — Right 3rd Seat Backrest Damaged	8	Not applicable	<a href="#">more</a>
V1759 — Left 3rd Seat Cushion Damaged	8	Not applicable	<a href="#">more</a>
V1760 — Right 3rd Seat Cushion Damaged	8	Not applicable	<a href="#">more</a>
V1761 — Rear Head Restraints	1	Equipped	<a href="#">more</a>

# MEASUREMENTS IN CENTIMETERS

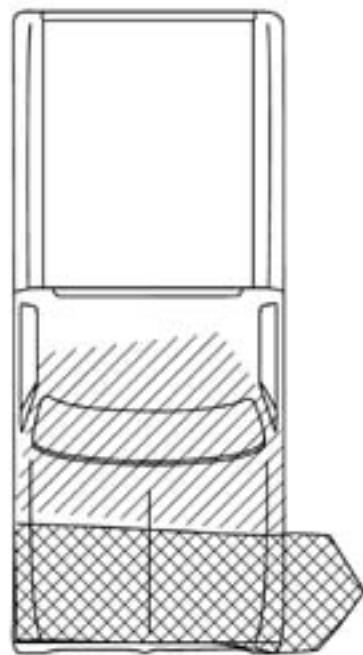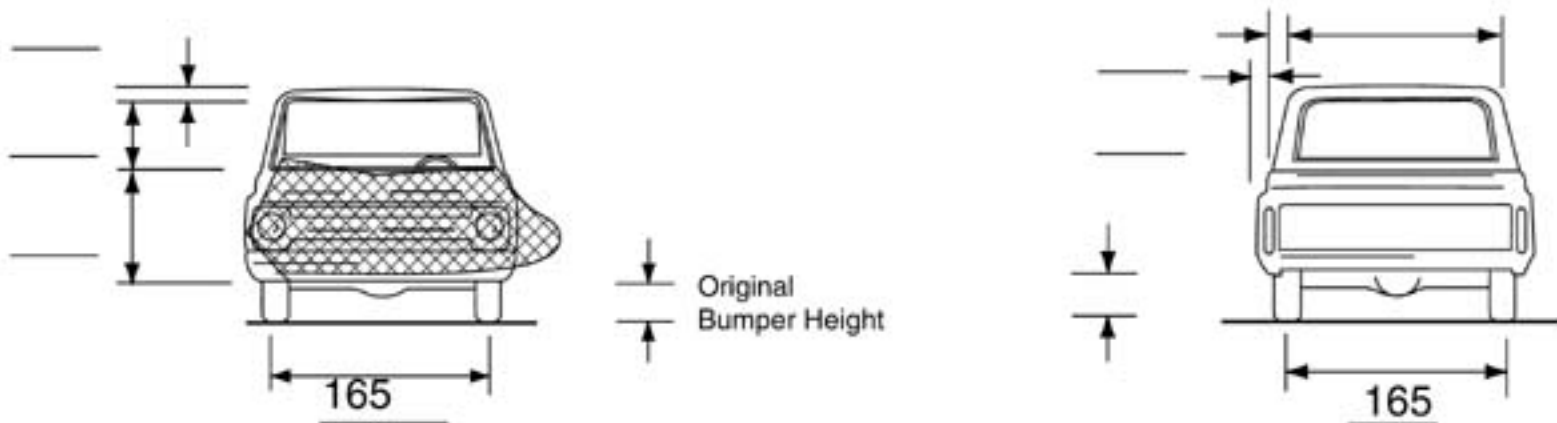


180 cm direct damage  
57 cm max crush  
impact # 1 and #2

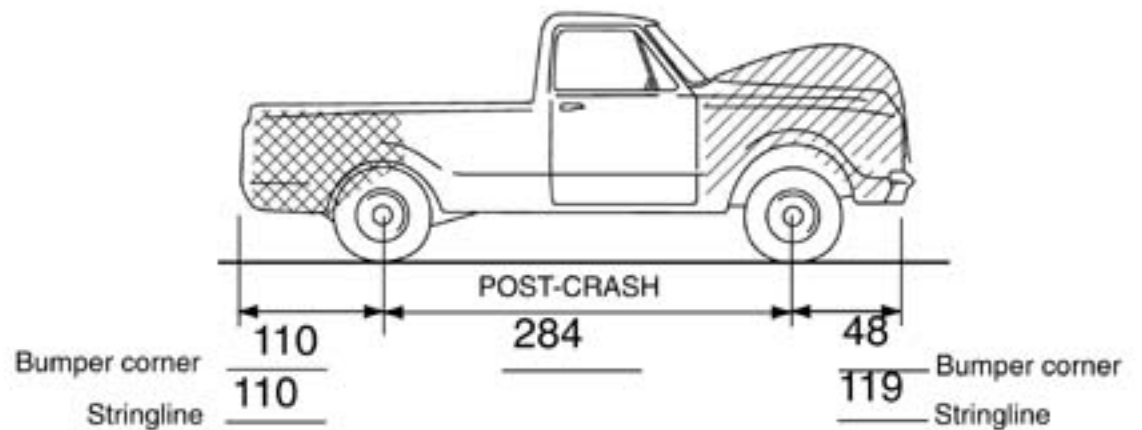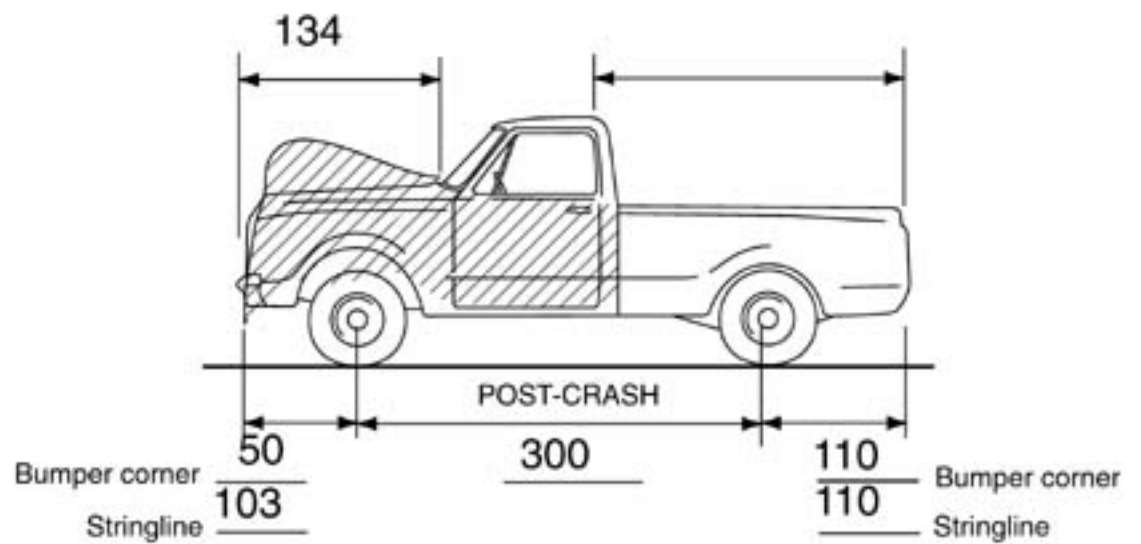

161 cm direct damage  
26 cm max crush  
Impact #3


# MEASUREMENTS IN CENTIMETERS

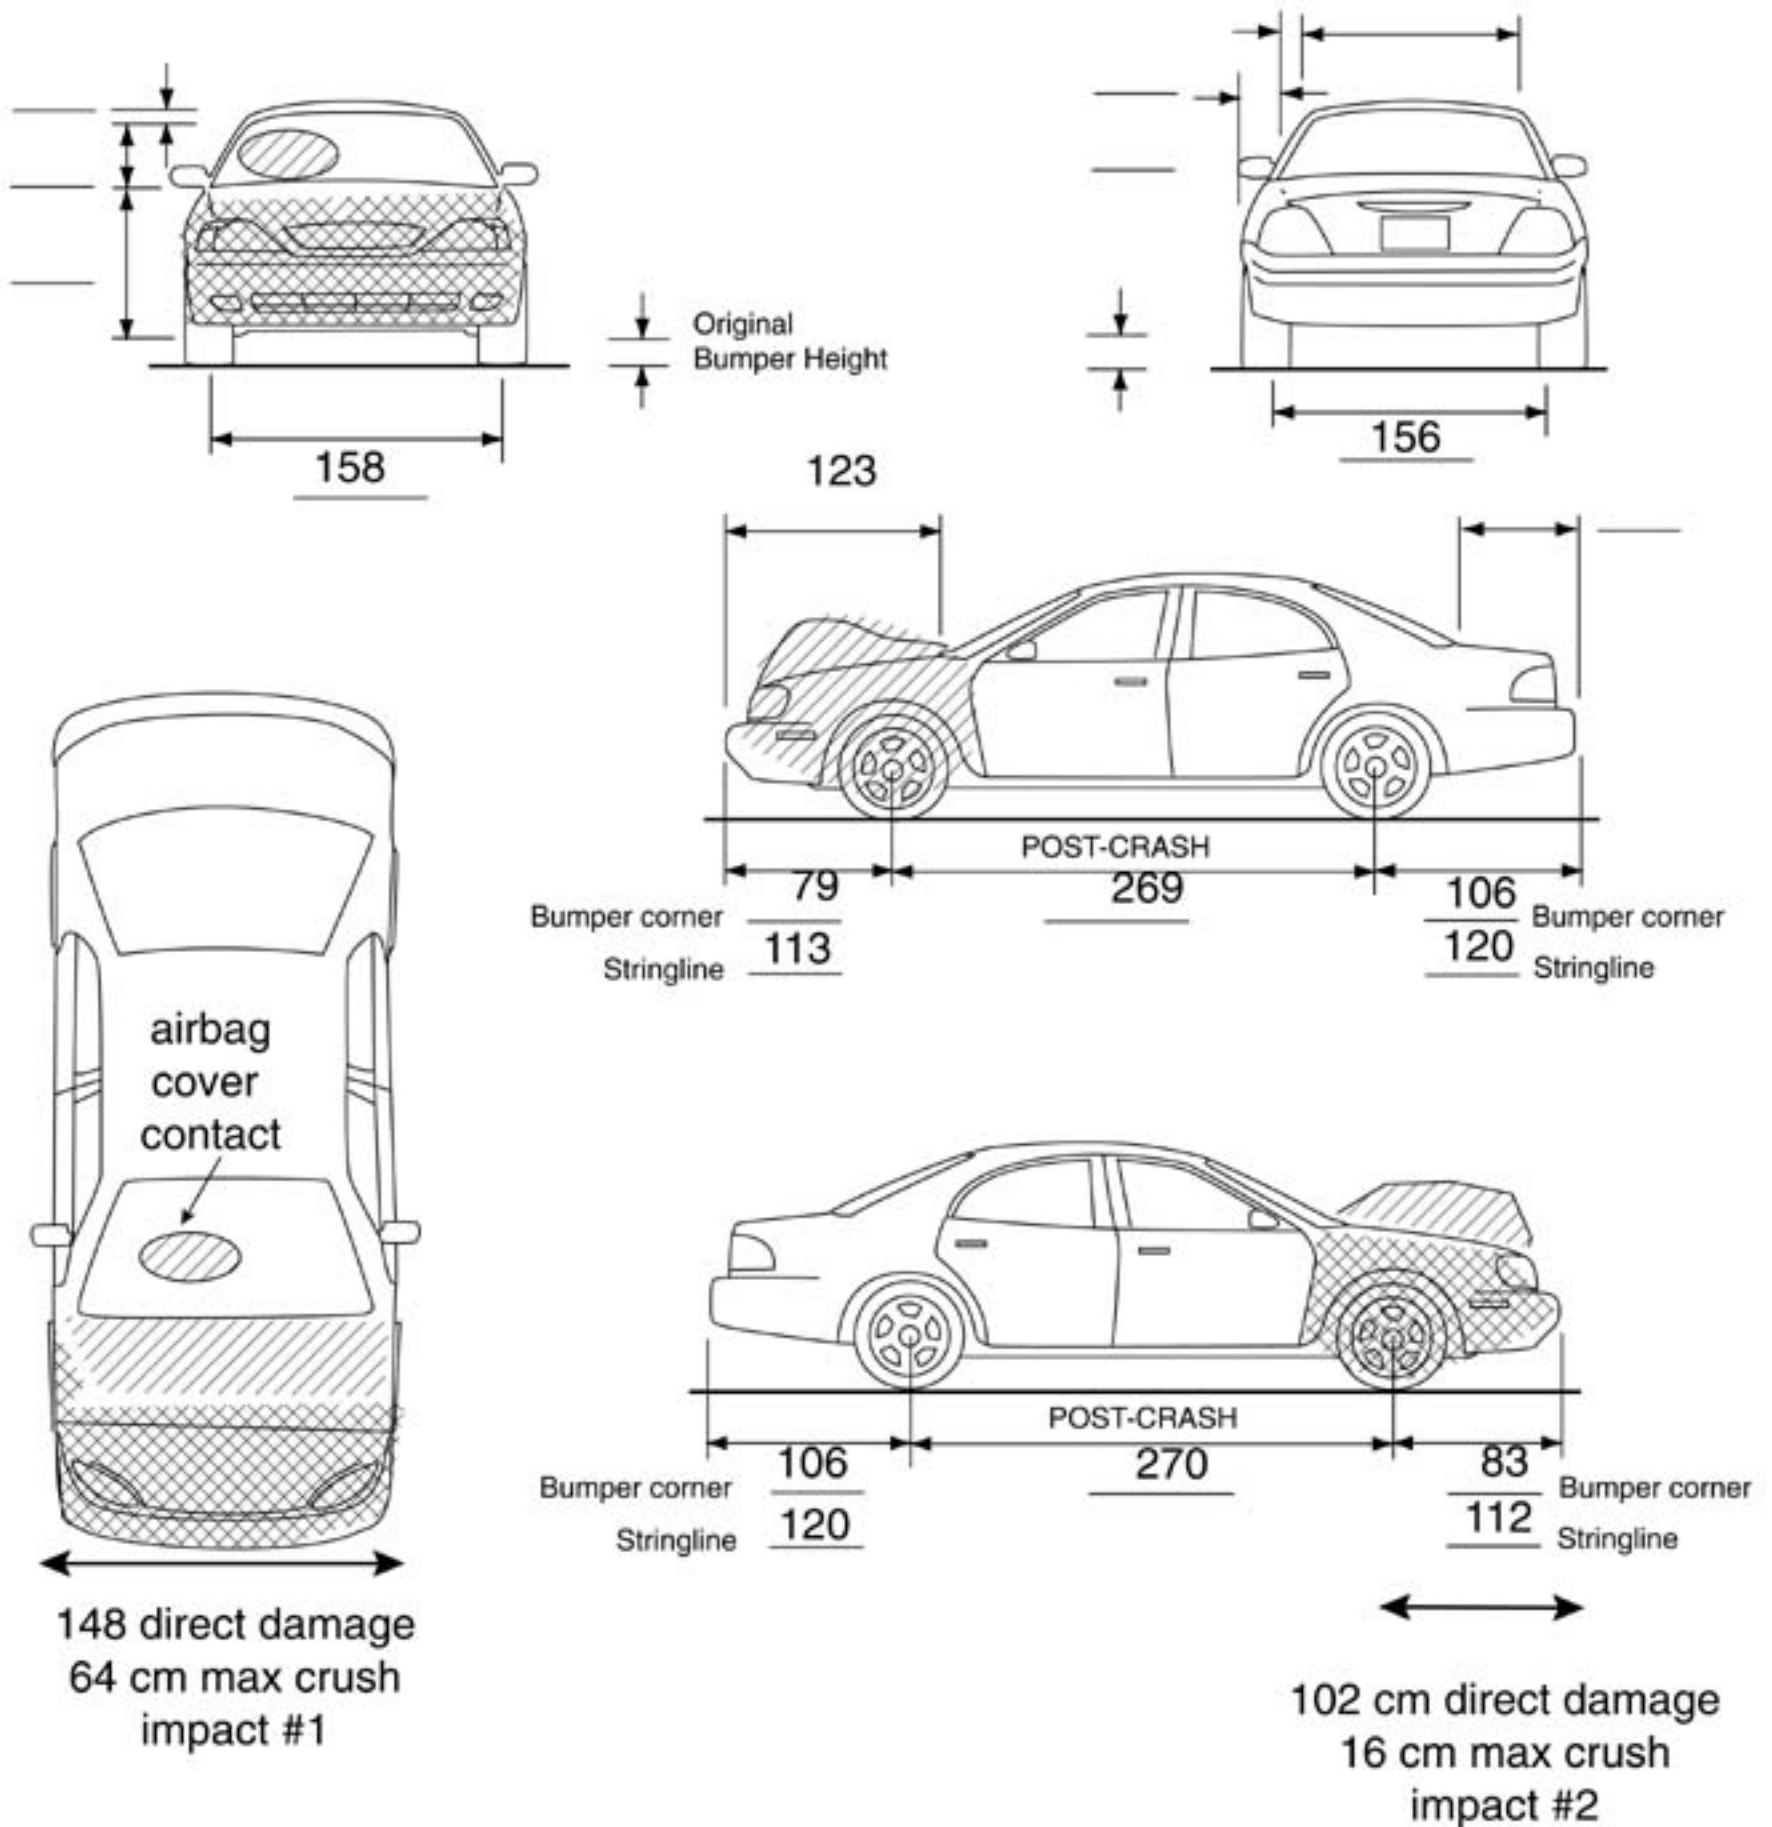



WINDSHIELD MARK ON CASE VEHICLE:

Unknown

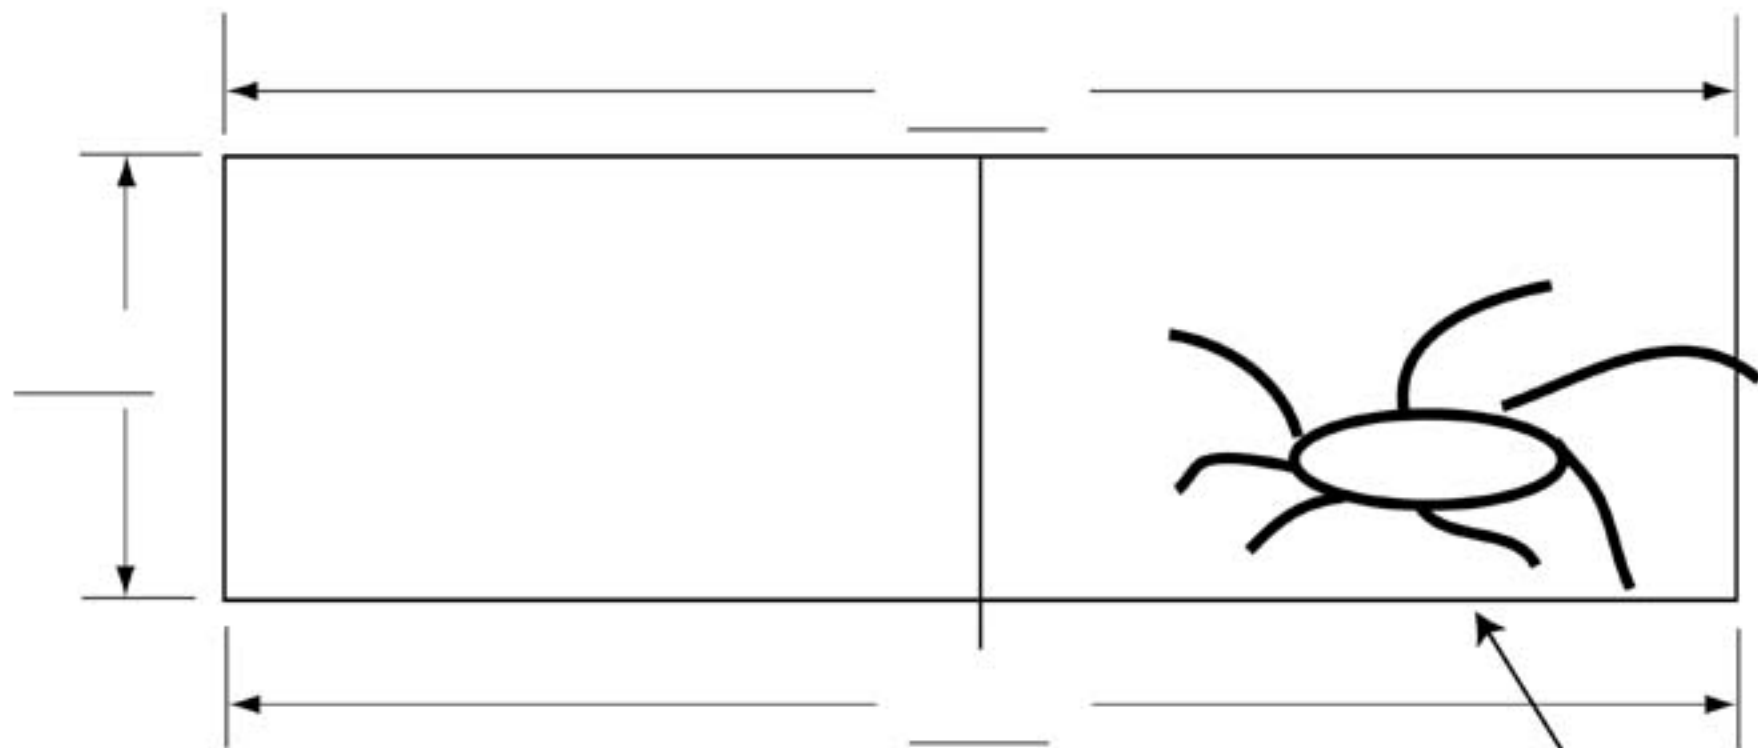

air bag cover  
contact



1 = Definitely 2 = Probably 3 = Possible

## INTRUSION IT-1

Location of Intrusion	Intruded Component	(All Measurements Are in Centimeters)			Dominant Crush Direction
		Comparison Value	–	Intruded Value = Intrusion	
None			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	


## OCCUPANT CONTACT WORKSHEET

Contact	Interior Component Contacted	Occupant No. if Known	Body Region if Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	Driver airbag	1	Face	Facial makeup	1
B	Knee bolster	1	Knee	Scuff and damage on left side	1
C	Knee bolster	1	Knee	Scuff and dent on right side	1
D	Rear of driver headrest	1	Head	Blood	2
E	Rear of driver seatback	1	Body	Blood	2
F	B-pillar	1	Head	Scuff mark	1
G					

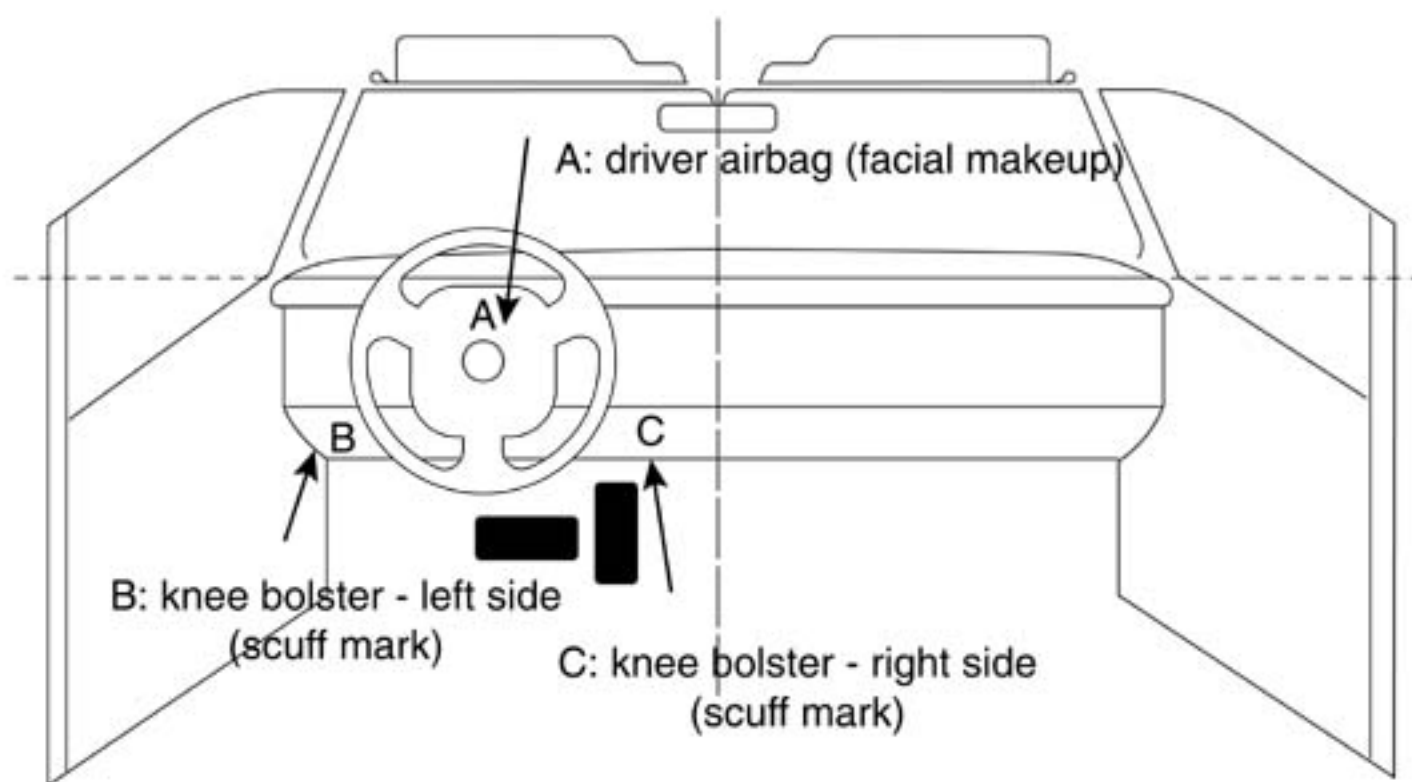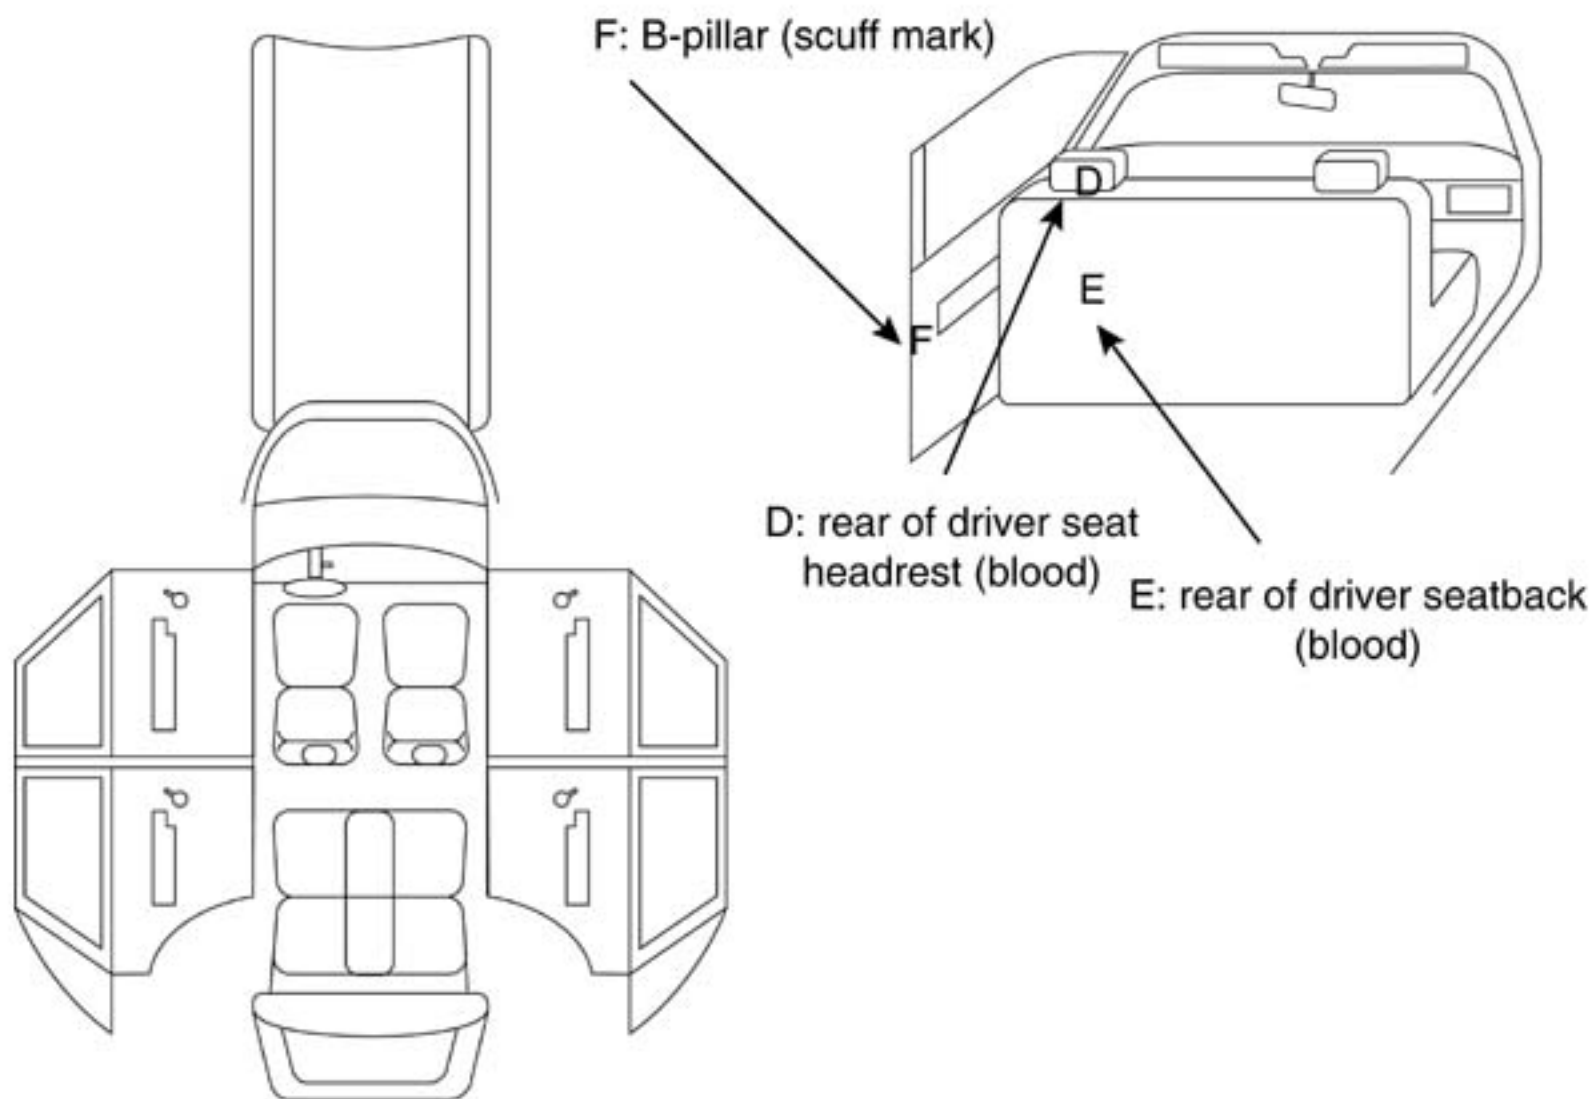


Driver Airbag

AIRBAG NUMBER ON DRIVER SIDE:

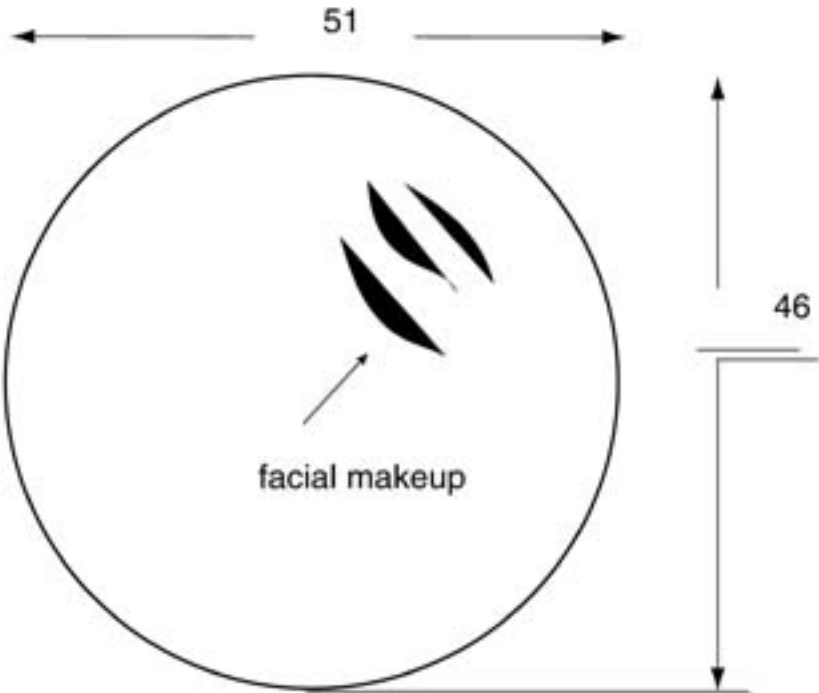


Driver Airbag Doors

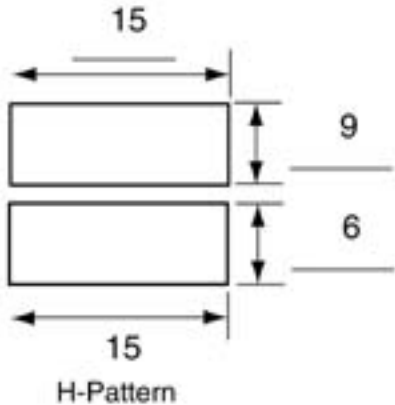

Vents: ☒ Y ☐ N  
if yes, how many: 2

Tethers: ☒ Y ☐ N  
if yes, how many: 1

### Passenger Airbag

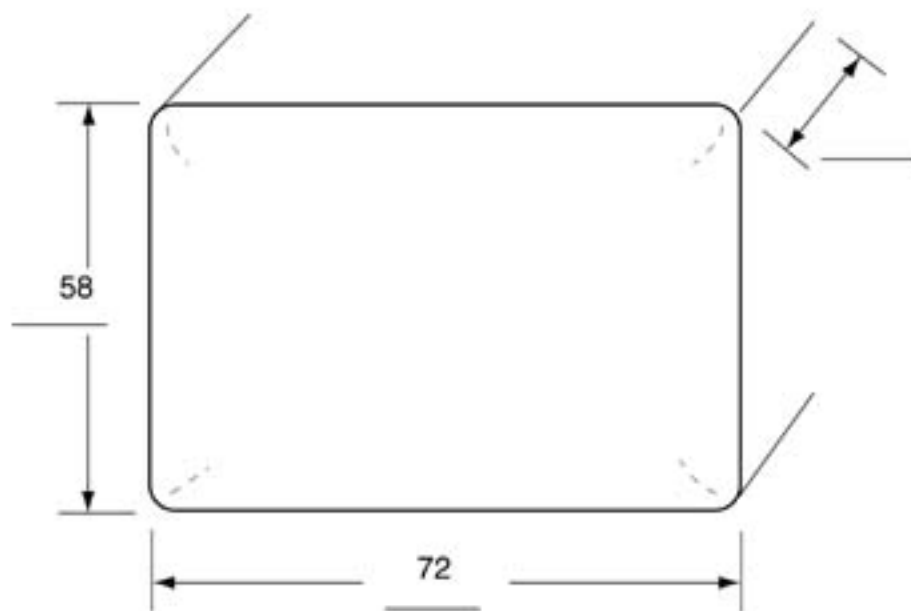


Vents: ☒ Y ☐ N 2  
if yes, how many: \_\_\_\_\_

Tethers: Y ☒ N  
if yes, how many: \_\_\_\_\_

### Passenger Airbag Doors

Single Door

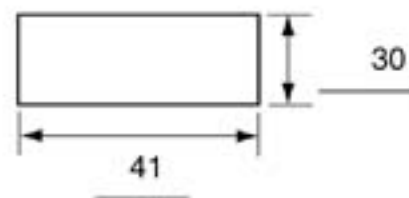

cover contacted and  
cracked the windshield

# Case # 246: Occupant # 1; Injury # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	01	Injury #1	<a href="#">more</a>
V2102 — 1st Prob Contact Area	48	Knee restraint	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	11	Knee	<a href="#">more</a>
V2105 — Primary OIC -aspect	18	Right	<a href="#">more</a>
V2106 — Primary OIC -lesion	06	Fracture	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	19	Skeletal	<a href="#">more</a>
V2108 — Primary OIC -severity	2	Moderate	<a href="#">more</a>
V2109 — Primary OIC	KRFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

# Case # 246: Occupant # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2001 — Occupant Number	01	Occupant #1	<a href="#">more</a>
V2002 — Occupant Role At 1st Impact	1	Motor vehicle driver	<a href="#">more</a>
V2003 — Occupant Position -row	1	1st row	<a href="#">more</a>
V2004 — Occupant Position -lateral	1	Left	<a href="#">more</a>
V2005 — Occupant Position -posture	10	Sitting on seat	<a href="#">more</a>
V2006 — Occupant Age In Years	50	—	—
V2007 — Occupant Age In Months	25	25 months or older	<a href="#">more</a>
V2008 — Occupant Mass	063 kg	—	—
V2009 — Occupant Height	173 cm	—	—
V2010 — Occupant Sex	2	Female	<a href="#">more</a>
V2011 — Occupant Treatment/Mortality	04	Hospitalized over 24 hrs or for significant treatment	<a href="#">more</a>
V2012 — Injury Severity Score	04	ISS 4	<a href="#">more</a>
V2013 — Non-impact Med Condition	0	None	<a href="#">more</a>
V2014 — Police Injury Severity	7	Non-fatal Injury, severity unknown	<a href="#">more</a>
V2015 — Active Restraint System	3	Both lap belt and shoulder harness	<a href="#">more</a>
V2016 — Active Restraint Usage	3	Both lap belt and shoulder harness	<a href="#">more</a>
V2017 — Passive Restraint System	1	Air bag installed	<a href="#">more</a>
V2018 — Passive Restraint Usage	2	Air bag deployed	<a href="#">more</a>
V2019 — Child Seat Type	88	Not applicable (adult or older child)	<a href="#">more</a>
V2020 — Occupant Ejection Degree	0	None	<a href="#">more</a>
V2021 — Occupant Ejection Area	98	Not applicable (not ejected)	<a href="#">more</a>



V2022 — Highest OIC Severity	2	Moderate	<a href="#">more</a>
V2023 — Head Restraint Available	1	Equipped	<a href="#">more</a>
V2024 — Occupant Eyewear	9	Unknown	<a href="#">more</a>
V2025 — Source of Occupant Info	0	Interview	<a href="#">more</a>

# Case # 246: Occupant # 2; Injury # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	01	Injury #1	<a href="#">more</a>
V2102 — 1st Prob Contact Area	15	B-pillar	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	72	Objects (penetrating)	<a href="#">more</a>
V2104 — Primary OIC -body Region	06	Face	<a href="#">more</a>
V2105 — Primary OIC -aspect	19	Superior/upper	<a href="#">more</a>
V2106 — Primary OIC -lesion	12	Laceration	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	2	Moderate	<a href="#">more</a>
V2109 — Primary OIC	FSLI 2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 246: Occupant # 2; Injury # 2

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	02	Injury #2	<a href="#">more</a>
V2102 — 1st Prob Contact Area	20	Surface of side interior	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	06	Face	<a href="#">more</a>
V2105 — Primary OIC -aspect	19	Superior/upper	<a href="#">more</a>
V2106 — Primary OIC -lesion	12	Laceration	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	FSLI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 246: Occupant # 2; Injury # 3

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	03	Injury #3	<a href="#">more</a>
V2102 — 1st Prob Contact Area	34	Restraint system webbing	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	03	Chest	<a href="#">more</a>
V2105 — Primary OIC -aspect	03	Central	<a href="#">more</a>
V2106 — Primary OIC -lesion	12	Laceration	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	01	Arteries	<a href="#">more</a>
V2108 — Primary OIC -severity	4	Severe	<a href="#">more</a>
V2109 — Primary OIC	CCLA4	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 246: Occupant # 2; Injury # 4

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	04	Injury #4	<a href="#">more</a>
V2102 — 1st Prob Contact Area	34	Restraint system webbing	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	13	Abdomen	<a href="#">more</a>
V2105 — Primary OIC -aspect	09	Inferior/lower	<a href="#">more</a>
V2106 — Primary OIC -lesion	12	Laceration	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	04	Digestive	<a href="#">more</a>
V2108 — Primary OIC -severity	2	Moderate	<a href="#">more</a>
V2109 — Primary OIC	MILD2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 246: Occupant # 2; Injury # 5

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	05	Injury #5	<a href="#">more</a>
V2102 — 1st Prob Contact Area	34	Restraint system webbing	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	13	Abdomen	<a href="#">more</a>
V2105 — Primary OIC -aspect	09	Inferior/lower	<a href="#">more</a>
V2106 — Primary OIC -lesion	12	Laceration	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	04	Digestive	<a href="#">more</a>
V2108 — Primary OIC -severity	2	Moderate	<a href="#">more</a>
V2109 — Primary OIC	MILD2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 246: Occupant # 2; Injury # 6

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	06	Injury #6	<a href="#">more</a>
V2102 — 1st Prob Contact Area	34	Restraint system webbing	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	13	Abdomen	<a href="#">more</a>
V2105 — Primary OIC -aspect	09	Inferior/lower	<a href="#">more</a>
V2106 — Primary OIC -lesion	12	Laceration	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	04	Digestive	<a href="#">more</a>
V2108 — Primary OIC -severity	2	Moderate	<a href="#">more</a>
V2109 — Primary OIC	MILD2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

# Case # 246: Occupant # 2; Injury # 7

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	07	Injury #7	<a href="#">more</a>
V2102 — 1st Prob Contact Area	34	Restraint system webbing	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	13	Abdomen	<a href="#">more</a>
V2105 — Primary OIC -aspect	09	Inferior/lower	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	MICI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—



## Case # 246: Occupant # 2; Injury # 8

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	08	Injury #8	<a href="#">more</a>
V2102 — 1st Prob Contact Area	34	Restraint system webbing	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	13	Abdomen	<a href="#">more</a>
V2105 — Primary OIC -aspect	09	Inferior/lower	<a href="#">more</a>
V2106 — Primary OIC -lesion	18	Rupture	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	13	Muscles	<a href="#">more</a>
V2108 — Primary OIC -severity	2	Moderate	<a href="#">more</a>
V2109 — Primary OIC	MIRM2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 246: Occupant # 2; Injury # 9

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	09	Injury #9	<a href="#">more</a>
V2102 — 1st Prob Contact Area	89	Under seat bottom	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	12	Leg (lower)	<a href="#">more</a>
V2105 — Primary OIC -aspect	18	Right	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	LRCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

# Case # 246: Occupant # 2; Injury #10

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	10	Injury #10	<a href="#">more</a>
V2102 — 1st Prob Contact Area	89	Under seat bottom	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	17	Ankle/foot	<a href="#">more</a>
V2105 — Primary OIC -aspect	18	Right	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	QRCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 246: Occupant # 2

Variable Number and Name	Code Value	Code Description	Other Options
V2001 — Occupant Number	02	Occupant #2	<a href="#">more</a>
V2002 — Occupant Role At 1st Impact	2	Motor vehicle passenger	<a href="#">more</a>
V2003 — Occupant Position -row	2	2nd row	<a href="#">more</a>
V2004 — Occupant Position -lateral	1	Left	<a href="#">more</a>
V2005 — Occupant Position -posture	10	Sitting on seat	<a href="#">more</a>
V2006 — Occupant Age In Years	09	—	—
V2007 — Occupant Age In Months	25	25 months or older	<a href="#">more</a>
V2008 — Occupant Mass	054 kg	—	—
V2009 — Occupant Height	152 cm	—	—
V2010 — Occupant Sex	2	Female	<a href="#">more</a>
V2011 — Occupant Treatment/Mortality	04	Hospitalized over 24 hrs or for significant treatment	<a href="#">more</a>
V2012 — Injury Severity Score	24	—	—
V2013 — Non-impact Med Condition	0	None	<a href="#">more</a>
V2014 — Police Injury Severity	7	Non-fatal Injury, severity unknown	<a href="#">more</a>
V2015 — Active Restraint System	3	Both lap belt and shoulder harness	<a href="#">more</a>
V2016 — Active Restraint Usage	7	Improper Usage	<a href="#">more</a>
V2017 — Passive Restraint System	0	None	<a href="#">more</a>
V2018 — Passive Restraint Usage	8	Not applicable (not originally equipped)	<a href="#">more</a>
V2019 — Child Seat Type	88	Not applicable (adult or older child)	<a href="#">more</a>
V2020 — Occupant Ejection Degree	0	None	<a href="#">more</a>
V2021 — Occupant Ejection Area	98	Not applicable (not ejected)	<a href="#">more</a>

V2022 — Highest OIC Severity	4	Severe	<a href="#">more</a>
V2023 — Head Restraint Available	1	Equipped	<a href="#">more</a>
V2024 — Occupant Eyewear	9	Unknown	<a href="#">more</a>
V2025 — Source of Occupant Info	0	Interview	<a href="#">more</a>



RIGHT L  
MUS  
TURN R



NO  
TURN  
ON  
RED


































































































































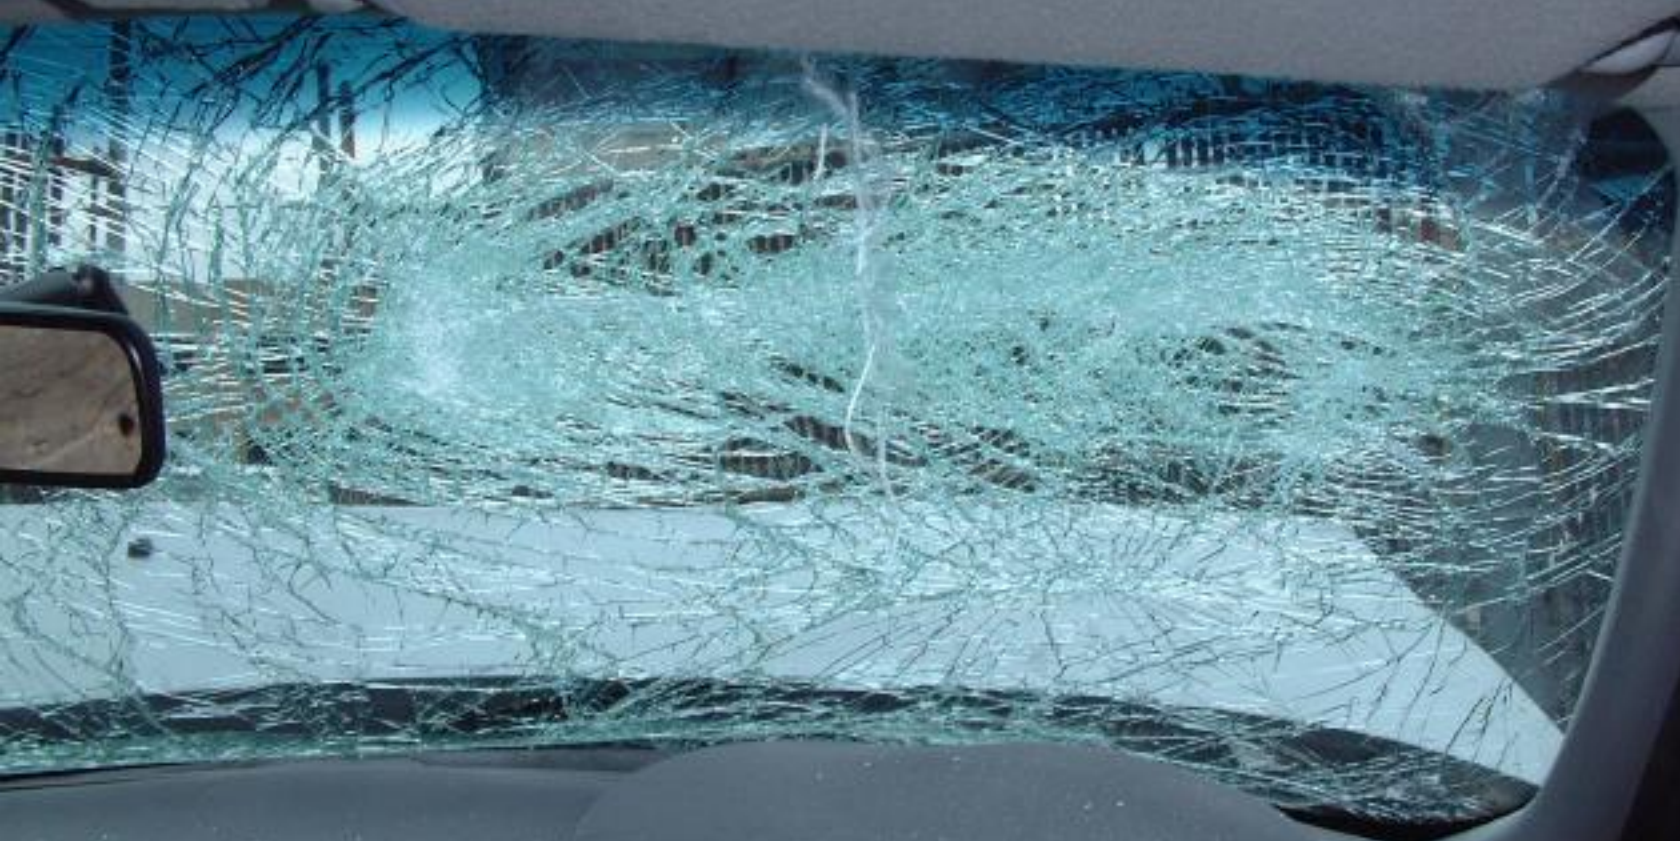



**WARNING**  
Do not place any objects on the dashboard or in the front of the vehicle. This could interfere with the proper operation of the air bag system and increase the risk of injury or death.

**WARNING**  
Do not place any objects on the dashboard or in the front of the vehicle. This could interfere with the proper operation of the air bag system and increase the risk of injury or death.



















































